

Investigation of Concrete from I-20 Near Monroe, Louisiana

by G. Sam Wong



Approved For Public Release; Distribution Is Unlimited

19980414 095

DTIC QUALITY INSPECTED 4

The contents of this report are not to be used for advertising, publication, or promotional purposes. Citation of trade names does not constitute an official endorsement or approval of the use of such commercial products.

The findings of this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.



Investigation of Concrete from I-20 Near Monroe, Louisiana

by G. Sam Wong


U.S. Army Corps of Engineers Waterways Experiment Station 3909 Halls Ferry Road Vicksburg, MS 39180-6199

Final report

Approved for public release; distribution is unlimited

Prepared for U.S. Army Corps of Engineers Washington, DC 20314-1000

Under Work Unit 32639

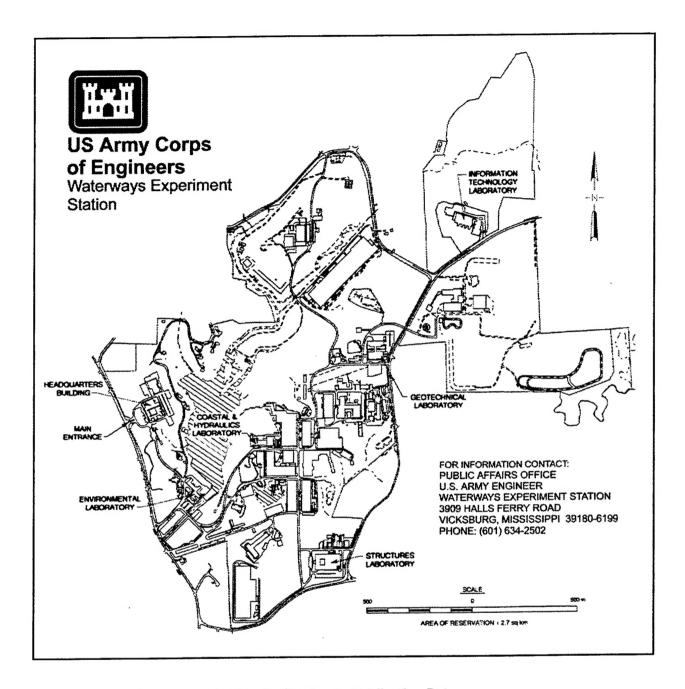

Waterways Experiment Station Cataloging-in-Publication Data

Wong, G. Sam.

Investigation of concrete from I-20 near Monroe, Louisiana / by G. Sam Wong; prepared for U.S. Army Corps of Engineers.

80 p.: ill.; 28 cm. — (Miscellaneous paper; SL-98-1)

Includes bibliographic references.

1. Pavements, Concrete — Louisiana — Testing. 2. Pavements, Flexible — Louisiana — Testing. 3. Concrete — Deterioration — Louisiana — Testing. I. United States. Army. Corps of Engineers. II. U.S. Army Engineer Waterways Experiment Station. III. Structures Laboratory (U.S. Army Engineer Waterways Experiment Station) IV. Title. V. Series: Miscellaneous paper (U.S. Army Engineer Waterways Experiment Station); SL-98-1. TA7 W34m no.SL-98-1

Contents

Preface i	v
1—Background	1
2—Evaluation Procedures and Results	2
Results of Cores	3 7
3—Conclusions and Recommendations	9
References	3
Figures 1-29	
Tables 1-4	
Appendix A: Photographs of Concrete Sections	1
Appendix B: U.S. Army Corps of Engineers Evaluation Data B	1
SF 298	

Preface

The research reported in this Miscellaneous Paper was conducted by the Structures Laboratory (SL), U.S. Army Engineer Waterways Experiment Station (WES), under the sponsorship of the Louisiana Transportation Research Center and the Portland Cement Association (PCA Project Index No. 95-04). This investigation was conducted under the general supervision of Messrs. Bryant Mather, Director, SL, and John Ehrgott, Assistant Director, SL. Direct supervision was provided by Dr. Paul F. Mlakar, Chief, Concrete and Materials Division (CMD), SL. Mr. G. Sam Wong, CMD, was the principal investigator of the study and author of this report.

Funds for the publication of the report were provided from those made available for operation of the Concrete Technology Information Analysis Center (CTIAC), SL. This is CTIAC Report No. 92.

The contents of this paper reflect the views of the author, who is responsible for the facts and accuracy of the data presented. The contents do not necessarily reflect the views of Louisiana Transportation Research Center or the Portland Cement Association.

At the time of publication of this report, Director of WES was Dr. Robert W. Whalin. Commander was COL Robin R. Cababa, EN.

The contents of this report are not to be used for advertising, publication, or promotional purposes. Citation of trade names does not constitute an official endorsement or approval of the use of such commercial products.

1 Background

On 2 December 1994, the Louisiana Department of Transportation (LDOT) asked a representative of the U.S. Army Engineer Waterways Experiment Station (WES), Structures Laboratory, to make a field inspection of concrete deterioration on I-20 west of Vicksburg, MS. The inspection, participated in by Messrs, B. Mather, WES; W. H. Temple and N. A. Rabalais, Louisiana Transportation Research Center; and S. W. Foster and P. J. Arena, Federal Highway Administration, took place on 10 January 1995. Following this inspection, Mr. G. S. Wong, Concrete Technology Division (CTD)¹, Structures Laboratory, WES, submitted a proposal to LDOT. This report covers the investigation conducted to determine the probable cause of concrete pavement deterioration in certain lanes of I-20 both east and west of Monroe, LA. Field examination of the pavement by the Department of Transportation and Development (DOTD). State of Louisiana, indicated that concrete near ioints was more affected than elsewhere. The concrete in the westbound lanes shows less deterioration than in the eastbound lanes. Some sections of the eastbound lane have been repaired with asphalt.

The concrete represented by the cores was placed as part of projects 451-07-29 east of Monroe and 451-05-0060 west of Monroe during the years 1987 to 1991. The cement came from Lone Star, Cape Girardeau, MO, and Ash Grove, Foreman, AR, respectively, for which typical mill test reports indicated Na₂O_{eq} varying from 0.4 to 0.5 percent. The coarse aggregate was crushed limestone from the Dravo quarry at Smithland, KY. The fine aggregate was natural sand. Class C fly ash from Gifford Hill, Boyce, LA, was used in all of the concrete west of Monroe, represented by cores No. 1 - 6. Fifteen cores were received from the DOTD for use in this investigation. The cores were selected to represent areas of distress as well as non-distressed areas from the different sections of roadway of interest. Each core was given a CTD serial number. The CTD numbers and the accompanying field description of each are provided in Table 1.

1

¹ The former Concrete Technology Division (CTD) is now designated Concrete and Materials Division (CMD).

2 Evaluation Procedures and Results

Cores were examined and logs made showing the general description of each core. Evaluation specimens also were selected at that time. Evaluations were planned to address the following: (a) the role of alkali- carbonate-rock reaction; (b) the role of alkali-silica reaction; (c) contribution of freezing and thawing action to the deterioration; (d) contribution of fresh concrete properties and construction practices to the deterioration. The evaluation matrix is given in Table 2.

Pulse velocities were determined for 12 of the 15 cores received. Pulse velocities were determined according to American Society for Testing and Materials (ASTM) C 597, "Standard Test Method for Pulse Velocity Through Concrete."

Petrographic examination of the concrete was performed using guidance from ASTM C 856, "Standard Practice for Petrographic Examination of Hardened Concrete." Selected coarse-aggregate particles were extracted from the concrete and examined by X-ray diffraction to determine mineral composition. All photographs were taken of sawed, ground, lapped surfaces prepared essentially as suggested in ASTM C 856 and C 457.

Petrographic examination of the aggregates was performed on coarse-aggregate particles extracted from the concrete as well as from the samples provided. This examination was performed using guidance from ASTM C 295, "Standard Guide for Petrographic Examination of Aggregates for Concrete." All photographs were taken of sawed, ground, and lapped surfaces prepared essentially as suggested in ASTM C 856 and C 457.

Volume stability of the aggregate was determined using ASTM C 586, "Standard Test Method for Potential Alkali Reactivity of Carbonate Rocks for Concrete Aggregates (Rock Cylinder Method)." Small-diameter cylinders were cored from coarse-aggregate particles and subjected to 1N solution of NaOH, and the cylinders were measured periodically to determine changes in length.

Cement-content analyses were performed on four cores. Cores 950617 and 950626 represented concrete from the eastbound lane, and cores 950621 and 950623 represented concrete from the westbound lane. Cement contents were determined using the draft¹ maleic-acid procedure developed by ASTM C 09.69 for inclusion as a revision of "Standard Test Method for Portland-Cement Content on Hardened Hydraulic-Cement Concrete," ASTM C 1084.

Results of Cores

Cores 950623 and 950624 represented concrete in the westbound lane west of Monroe. Some hairline cracks were observed, and they tended to be near the top surface with vertical extent less that 0.05 ft (0.02 m). Both cores were approximately 1 ft (0.3048 m) in length and were of air-entrained concrete. Limestone coarse-aggregate particles were light gray. The logs for cores 950623 and 950624 are shown in Figures 1 and 2, respectively.

Cores 950625, 950626, 950627, and 950628 represent concrete from the eastbound lane west of Monroe. Cores 950625 and 950626 contained reinforcing steel at approximately 0.5-ft (0.15 m) depth. Some lateral cracks were found associated with the reinforcing steel. Core 950627 was intact throughout. Cores 950625, 950626, and 950628 contained some cracking throughout the length of the cores, with cracking more numerous near the surface of the pavement. Cracks were vertical, horizontal, and diagonal. Cores 950625, 950626, and 950628 contained dark-aggregate particles showing some fracturing, as indicated on the logs given in Figures 3 through 6.

Cores 950620, 950619, 950617, 950614, 950616, 950622, and 950618 were from the eastbound lane east of Monroe. The condition of the cores ranged from heavy cracking to no cracks in the concrete, as shown in the core logs given in Figures 7 through 13.

Cores 950621 and 950615 represent concrete in the westbound land east of Monroe. These cores contained very light cracking to no cracks. The coarse aggregate was composed mostly of light-gray limestone particles. The darker limestone coarse-aggregate particles tended to be small. There was a small vertical crack at the bottom of core 950621 associated with a dark limestone particle that contained a reaction rim as well as a fracture in the particle. The concrete was in good condition, as described in the core logs given in Figures 14 and 15.

The pulse velocities were generally above 11,000 ft/sec (3,353 m/sec) with two samples, 950626 and 950628, having lower velocities of 10,600 ft/sec

¹ The specific draft used was Draft #5, 1 June 1994, but the results are regarded as being insignificantly different from those that would have been obtained had the later draft dated 14 November 1995 been followed.

(3,231 m/sec) and 7,560 ft/sec (2,304 m/sec), respectively. The Table 3 tabulates the data for the individual specimens.

The core logs describe the general condition of each core. The following section describes some notable features of the concrete and includes more detailed information on the structure and the composition.

- a. 950623 This core was cut along its entire length to expose the interior concrete. A near-surface vertical crack was associated with subsurface dark-gray coarse-aggregate particles with prominent reaction rims. These particles showed some interior cracks. X-ray diffraction examination of one particle indicated that the particle was composed of a fine-grained dolomitic limestone containing some quartz and clay, as shown in Figure 16. Some interior, randomly oriented incipient cracks were also observed associated with dark-gray coarse-aggregate particles with reaction rims, as illustrated in Figure A1, Appendix A. These cracks were located in the lower portion of the core.
- b. 950625 Vertical cracks from the surface intersected dark-gray coarse-aggregate particles as well as horizontal intermittent fractures, as shown in Figure A2, Appendix A. All fractures could be traced to dark-gray coarse-aggregate particles with dark reaction rims either partially or entirely rimming the particle. No cracking was associated with similar smaller dark coarse-aggregate particles. Cracks in some particles were continuous into the paste while other cracks in the aggregate particles showed no such continuation. The paste was hard and intact.
- c. 950626 This concrete sustained localized damage. A single horizontal crack and some hairline fracturing were observed on a cut section on one side of the slab (Figure A3a, Appendix A). On the reverse side, heavy fracturing of the concrete associated with dark-gray coarse-aggregate particles was observed. Minor cracking at the bottom of the core associated with cracked dark-gray coarse aggregate is illustrated in Figure A3a, Appendix A. Examination of a thin section containing coarse-aggregate particles showed a linear opening along oriented features. The cracks contained no observed reaction products.
- d. 950627 This concrete was intact and generally contains mediumgrained light-gray limestone coarse aggregate. The paste was hard and intact, as shown in Figure A4, Appendix A.
- e. 950628 The concrete contained numerous cracks throughout the length of the core. The cracks were vertical, horizontal, and diagonal going through, as well as around, coarse-aggregate particles, as shown in Figures A5a and A5b, Appendix A. There were numerous

dark-gray fine-grained limestone coarse-aggregate particles in the concrete. Some of the pieces were large coarse-aggregate particles and some were small. Cracks were always associated with the larger pieces of aggregate of this nature and were less common with smaller pieces. Many of these pieces of aggregate showed open cracks in the interior of the particle. The X-ray diffraction pattern showed the coarse-aggregate particles to consist of a dolomitic limestone containing some quartz and clay (Figure 17).

- f. 950620 The core was cracked throughout its length. The cracks were randomly oriented. There were numerous dark-gray limestone coarse-aggregate particles with dark reaction rims. The rims exhibited radial cracks that extended into the paste. Aggregate particles with these rims were dolomitic limestone containing quartz and clay. X-ray diffraction patterns are presented in Figures 18 and 19. Figure A6, Appendix A, shows the appearance of these aggregate particles.
- g. 950619 The core was cracked throughout its length. Cracking in the near-surface concrete was more severe as vertical, horizontal, and diagonal cracks were common and associated with dark-gray limestone coarse-aggregate particles (Figure A7, Appendix A). Thin sections of two coarse-aggregate particles were prepared. Particle #A was a light-colored fine-grained limestone consisting of a fine-grained matrix and rhombohedral dolomite crystals. No cracks associated with this particle were observed. Particle #B was a dark-gray fine-grained limestone with a rim around it and was associated with cracking. No difference could be observed between the material in the rim and the interior of the particle. Fine quartz grains were embedded in a calcite matrix.
- h. 950617 This sample consisted of rubble. The core had broken into fragments during the coring process. One large piece was impregnated using an epoxy resin and then cut open for examination. The concrete was highly fractured (Figure A8, Appendix A). There were numerous dark-gray limestone coarse-aggregate particles. Cracks were mostly associated with the larger coarse-aggregate particles. The associated dark-gray coarse-aggregate particles were dolomitic limestone containing some quartz as well as illite (claymica). An X-ray diffraction chart showing the relative abundance of the calcite and dolomite is presented in Figure 20.
- i. 950614 Hairline vertical cracks were observed to penetrate approximately 1 in. (25.4 mm) into the concrete. Some incipient fractures were observed in the concrete. The coarse aggregate was primarily a light-colored limestone.

- j. 950616 The surface cracking was light. However, the interior concrete showed an extensive crack system. A vertical crack extended several inches into the interior concrete going through coarse-aggregate particles as well as around them. The vertical cracks intersected horizontal and diagonal cracks (Figures A9a and A9b, Appendix A). The majority of the cracks were associated with cracked dark-gray fine-grained limestone coarse-aggregate particles. Two particles examined by X-ray diffraction were dolomitic limestone with acid-insoluble materials consisting of quartz and clays. Figures 21 and 22 illustrate the relative abundance of the carbonate phases.
- k. 950622 This sample was intact with no visible cracks. The coarse aggregate was light colored and did not contain any reaction rims (Figure A10, Appendix A). A single hairline crack at the bottom of the core, shown in Figure A10, Appendix A, was observed and seems unrelated to dark-gray coarse aggregate.
- 950618 This concrete was heavily cracked. Vertical, horizontal, and diagonal cracks were abundant throughout the length of core. The cracking was associated with a large dark-gray limestone coarseaggregate particle (Figure A11, Appendix A). Fractures were observed in the central portion of the aggregate particle as well as in the rim area of the particle. A specimen of this aggregate particle was cored along the paste-to-aggregate interface and prepared for examination as a ground section. The specimen was impregnated using an epoxy resin to reinforce the sample and minimize possible additional cracking in the preparation process. The specimen showed the propagation of cracks through the interface zone. The cracks were not confined to the interface zone of the aggregate particle as they propagated into the interior of the aggregate particle. The interior portion of the aggregate particle was also cracked. High-resolution elemental analysis using the scanning electron microscope (SEM) and energy dispersive X-ray (EDX) showed no migration of elements in this particular aggregate particle, as illustrated in Figure 27.
- m. 950621 This concrete had some hairline cracks at the surface. One crack penetrated into the interior concrete approximately 1 in. (25.4 mm) and terminated in the paste. The upper portion of the concrete consisted of lighter colored limestone coarse-aggregate particles. The lower portion of the core contained numerous dark-limestone coarse-aggregate particles with dark reaction rims. Some cracks associated with these limestone aggregate particles are shown in Figure A12, Appendix A. The X-ray diffraction pattern of aggregate particle #A, a dark-gray particle with a prominent dark reaction rim, showed it to be pure limestone, as shown in Figure 23. Light-colored brownish limestone with a reaction rim (particle #B) was pure limestone, as identified in Figure 24. The dark-gray particle

with a prominent reaction rim (Figure A12, Appendix A) (particle #C) was a fine-grained dolomitic limestone also containing insoluble material including clays and quartz (Figure 25). A thin section of a near-surface dark-gray fine-grained impure limestone coarse-aggregate particle showed a rim on this aggregate and micro cracks in the rim propagating into the paste. Etching of coarse-aggregate particle using dilute hydrochloric acid showed no relief in the rim area; i.e., the rim was neither more nor less acid soluble than the unaltered rock.

n. 950615 - This concrete contained primarily light-colored limestone coarse-aggregate particles; some dark reaction rims were present on some of the coarse-aggregate particles (Figure A13, Appendix A). When etched with dilute hydrochloric acid, the rims showed no relief. The paste was intact and hard.

Thin sections of the reactive aggregate particle 950629B indicated the rock was composed of euhedral to subhedral crystals of dolomite approximately 0.1-mm nominal size floating in a groundmass of calcite and other mineral matter. Crystals in the groundmass were less than 0.015-mm nominal size. Reactive particle 950630B contained subhedral dolomite crystals with a nominal size of 0.04 mm in a fine-grained groundmass. Both were impure dolomitic limestones.

Rock-cylinder expansion measurements indicated that some of the aggregate particles were highly reactive when stored in sodium hydroxide in accordance with ASTM C 586. Figures 28 and 29 show expansion data up to 64 days. The specimens were immersed in water for 7 days and showed no change in length. Specimens from both limestone samples included aggregate materials that expanded significantly. Sample 950629 showed immediate expansion and rose to above 3 percent at 35 days; measurements were terminated for these particular specimens as they began to fall apart. Sample 950630 yielded specimens that expanded to above 0.4 percent in 64 days in sodium hydroxide. Analysis of a highly expansive particle in 950629 (particle B) indicated the sample to be composed of dolomitic limestone containing some quartz and clay. No reaction products were detected by X-ray diffraction analysis, as shown in Figure 26.

Cement-content analysis indicated that three samples contained 420 to 438 lb/yd³ (249 to 260 kg/m³), and one sample had a cement content of over 600 lb/yd³ (356 kg/m³). The results are shown in the Table 4.

Results of Samples

All cement paste was hard and intact. No evidence of sulfate attack was detected. Although ettringite crystals in voids are not necessarily evidence of sulfate attack, the absence of ettringite in the fracture surfaces and in voids is a positive indication of the absence of sulfate attack.

There was no scaling of the concrete observed, the concrete was adequately air entrained, and the typical freezing and thawing damage caused when paste is critically saturated was not observed. Generally, when the freezing isotherm goes through the concrete, it will create stresses normal to the surface resulting in cracking that tends to be subparallel to parallel to the surface of the concrete. Cracking in the cores that contained cracks tended to be random in orientation. Based on these observations, it was regarded as unnecessary to conduct quantitative work according to ASTM C 457 to develop data on the air-void system of the concrete.

Hairline cracks with only near-surface penetration are most likely drying shrinkage cracks caused by loss of the moisture from the concrete. This was observed in most of the cores examined.

Alkali-silica reaction was minimal. Alkali-silica gel was observed only in isolated voids. No alkali-silica reaction products were observed in the cracks in the concrete.

Carbonate-rock reaction was common throughout the pavement in all sections. The amount of deleteriously reactive aggregate varied from location to location from and within a location. There is significant evidence that much of the cracking is related to dark-gray dolomitic limestone coarse-aggregate particles. Many of the cracks seem to propagate from these coarse-aggregate particles.

It is believed that this reaction is continuing in the pavement in some locations as some of the aggregate particles show major fracturing of the particle itself and fractures into the adjacent paste and concrete. Other particles are only minimally cracked, and it is likely that these have the potential to continue to experience disruptive volume change. In other places, there was no surface expression of deterioration but some reactive aggregates were identified deeper in the pavement with associated cracks. This may reduce the service life of the pavement section in which this is present.

Not all of the cracking is solely attributed to the carbonate-rock reaction. In some areas where cracking is severe, there does not appear to be sufficient reactive aggregates to suggest that this reaction is solely responsible for the deterioration. Because deterioration seems to be observed first along joints, pavement edges, and approach ramps to bridges, the weakening of the concrete by carbonate-rock reaction is most likely aggravated by loading due to traffic.

3 Conclusions and Recommendations

Deterioration of the concrete is evidenced by cracking and raveling of the pavement. In this investigation, we have identified some deterioration in which there is minimal evidence at the concrete surface. Where there is disruption of the paste, incipient cracks present in the concrete will open during continued loading. It is also envisioned that the cracks can be filled with water and during freezing, wedging action could work to increase damage to the concrete. It is regarded as unlikely that freezing and thawing effects could do more than aggravate deterioration of already distressed concrete. The location is in the moderate weathering region designated in Figure 1 of ASTM C 33, "Standard Specification for Concrete Aggregates." In spite of this categorization, bridge-railing concrete on I-20 in Mississippi developed popouts due to freezing of critically saturated concrete containing porous-chert aggregate particles.

There were numerous dolomitic limestone particles in the smaller size fraction which when observed individually in the concrete appeared to have limited effect on the cracking of the concrete. When present in substantial numbers, deterioration of concrete was observed.

Pulse velocities of the cores, in general, can be separated into categories where above 12,000 ft/sec (3,658 m/sec) is considered good and that below is questionable. There is a lack of correlation in the observed information. The limited pulse-velocity information is not sufficient to categorize the integrity of the various concretes represented. Some of the cores containing cracks had relatively high pulse velocities.

Many of the coarse-aggregate particles reacted in the concrete. Reaction rims partially or entirely surrounded the particles. Not all of the coarse-aggregate particles reacted as some did not have reaction rims. Not all of the dark-gray particles that reacted were expansive. The reactive particles that were identified as expansive were particles of impure dolomitic limestone. Nonreactive dark-gray particles were pure limestone.

Traditional reactive carbonate-rock aggregates have a composition similar to that which is described as expansive in this concrete. There is no doubt that this concrete underwent internal expansion and cracking associated with alkalicarbonate rock reaction (ACR) involving dolomitic carbonate rock with the composition and texture of dolomites that have been identified at other places as associated with expansive deterioration of concrete. In many such cases, the deterioration is believed to have been initiated by a chemical reaction that alters the mineral dolomite (CaCO₃ · MgCO₃) to CaCO₃ (calcite) and Mg(OH)₂ (brucite). The CO₂ in the MgCO₃ typically combines with alkali and later with the calcium in the pore fluid of the concrete. It has been suggested that the expansive force is due to reaction of the alkali with clay minerals in the matrix of the rock. Since in the present case, no evidence of alteration of the dolomite (i.e., no production of Mg(OH), (brucite)) and no migration of elements across the coarse-aggregate paste interface were found, it is assumed that the source of the expansive force that produced the cracks radiating from the reactive coarse-aggregate particles is a chemical reaction and expansion of the clay minerals in the matrix. As noted, no expansion of the rock cylinders taken from the samples of crushed limestone was observed when soaked in water before being exposed to sodium hydroxide (NaOH), but in some cases, a large expansion was noted quite soon when exposed to NaOH.

Carbonate-rock reaction may continue indefinitely or until the moisture content falls below a certain level at which the reaction can no longer continue, since it is a chemical reaction involving diffusion of ions in the pore fluid of the concrete.

Bridge decks were treated as necessary with calcium magnesium acetate (CMA) as a deicing agent. ACR may be accelerated by the addition of sodium chloride, which is a common deicing agent. It is not expected that CMA would cause acceleration of the ACR.

The reactive aggregate particles were found in both aggregate samples examined (950629 and 950630). The testing of the aggregate was limited to particles large enough to obtain test specimens. The testing suggests the presence of alkali-carbonate reactive aggregate, but is not an indication of the amount of deleteriously reactive aggregate nor the reactiveness of the aggregate source.

Cement content is a variable in the concrete, but it does not seem to affect the quality of the concrete or the reaction in this situation.

Where the concrete contains fly ash, the measured cement contents are biased towards higher values, particularly if the concrete is old, so that the fly ash hydration is advanced, or if the concrete contains Class C fly ash, or both. All concrete from west of Monroe contained some fly ash.

The insoluble residue of the cement was analyzed in either duplicate or triplicate. This is the part of the analysis that appears to be most prone to

error; however, replication was good enough to indicate that the value for sample 950621 was significantly higher than the cement contents of the other three cores when means were compared in an analysis of variance procedure.

The deterioration of the concrete, samples of which were examined, is believed to be the consequences of a chemical reaction involving a type of rock present in the coarse aggregate that was used. The coarse aggregate is a carbonate rock that comes in a variety of types--both light colored and dark colored, with little or no quartz or clay (insoluble residue), and ranging from pure limestone (no significant amount of magnesium carbonate) to dolomite (about equal amounts of calcium and magnesium carbonate). The chemical reaction causes rims to form on some of these varieties, mostly the darkcolored ones, some dolomitic, some pure limestone. However, unless the rock is not only dark but also dolomitic and with a significant amount of quartz and clay, the rim-forming reaction does not seem to be accompanied by physical distress in the concrete. In the two samples of rock tested, only 2 of 12 and 2 of 10 showed expansion when evaluated as rock cylinders in accordance to ASTM C 586. The physical distress is manifested by cracking radiating from affected coarse-aggregate particles. The literature has suggested that such internal expansion can result from either the de-dolomitization reaction or as a secondary consequence of breakdown in the rock that allows fluid access to the included clay and the swelling of the clay. No evidence of de-dolomitization was developed in the work that was done. No brucite (Mg(OH)2) nor any migration of elements across the paste-coarse aggregate interface was detected. It may, therefore, be that the expansive force is produced by the swelling of the clay in the rock. It is reported that the cement used was low alkali; this may not preclude deleterious alkali-carbonate rock reaction since some scenarios for such reaction contemplate regeneration rather than sequestration of the alkali that participates in the reaction.

Deterioration of the pavement is related to the presence and abundance of deleterious reactive carbonate-rock coarse-aggregate particles reacting with the alkalies in the cement. Some of the pavement not already showing distress may continue to deteriorate, causing future pavement failure in areas not currently showing such distress. To identify portions of pavement with potential for deterioration would require an extensive coring program and the petrographic examination of the cores to identify the presence and absence of deleterious reactive aggregates. This may not be practical as there is variability within cores as well as between the cores examined, which was demonstrated during this investigation.

It is expected that the pavement will continue to be weakened by this reaction and that deterioration will be aggravated by traffic. The degree to which traffic aggravates the deterioration may well be influenced by differences from location to location in the bearing capacity of the foundation. As the pavements deteriorates, those areas should be removed and replaced.

It is recommended that this aggregate type be avoided in planning for future portland-cement concrete construction or precautions should be taken to minimize the alkali-carbonate rock reaction in the concrete if it is necessary to use this rock for aggregate. U.S. Army Corps of Engineers test data on this rock are given in Appendix B.

References

American Society for Testing and Materials. (1995). 1995 Annual Book of ASTM Standards. Philadelphia, PA.

Designation C 33, "Standard specification for concrete aggregates."

Designation C 295, "Standard guide for petrographic examination of aggregates for concrete."

Designation C 457, "Standard specifications for microscopial determination of parameters of the air-void system in hardened concrete."

Designation C 586, "Standard test method for potential alkali-reactivity of carbonate rocks for concrete aggregates (rock cylinder method)."

Designation C 597, "Standard test method for pulse velocity through concrete."

Designation C 856, "Standard practice for petrographic examination of hardened concrete."

Designation C 1084, "Standard test method for portland-cement content of hardened hydraulic-cement concrete."

References 13

											_
DRILLI	ING LOG	DIVISION		INSTALLAT		na Hw	y Dept.	SHEE	1	SHEETS	
1. PROJECT				10. SIZE	ND TYPE	OF BIT 6	1			SUEELS	1
		-20 Core	S	11. DATUM	FOR ELEV	ATION SH	OWN (TBM OR MS	SL)			7
2. LOCATION	(Coordinates o	r Station)		12. MANU	ACTURER'S	DESIGNAT	TION OF DRILL				-
3. DRILLING	AGENCY										
1 11015 110	(As shown on	drawing title			NO. OF O'N SAMPLES		DISTURBED	UNDI	STURBE	D	
and file n		Grawing inte	L-1								1
5. NAME OF	DRILLER				NUMBER C					_	1
6. DIRECTION	OF HOLE				TION GROUP	STAF		COMPLET	ED		┨
VERTICAL		o	DEG. FROM VERT	16. DATE							
7. THICKNESS	OF OVERBURD	EN		17. ELEVA							7
8. DEPTH DRI	ILLED INTO ROC	K			CORE REC		R BORING				-
9. TOTAL DEP	TH OF HOLE (.9 feet		13. 31011	TORE OF I	to Lotok					
			CLASSIFICATION OF MATERIA	LS	% CORE RECOV-	BOX OR SAMPLE NO.	/	REMARKS			7
ELEVATION	DEPTH LEGE	(DA)	(Description)		ERY	NO.	(Drilling tim	e, water i , etc. if :	oss, d signifi	epth of cant)	
0	0.0	Do Drag	finished surfa	ace							
		HL in	ncipient crack] - `						
	700	0.05	-ft.		1						
	000	8				1					
	7 67	300 0									
	000	198									
		0									L
		2				ļ					L
	7.00	\$ 0									L
-0.9	0.9	EOB (0.90-ft.								
		Flat	asphalt interf	ace							L
			in. max size Ls ıshed	CA,							_
			ceous FA, natur	al							_
		No se	egregation								L
			consolidation								_
			entrained #950623								-
		CID	+950625								-
											-
	-										-
	_					}					j-
	_					}					-
	'-										F.
											-
											H
											\vdash
											-
	-										-
	-										\vdash
					1	1				÷	-
	-										
					1						
	-					-					\vdash
	-										-
	ı ⊣				1		1				\vdash

Figure 1. Log of core 950623

				LANCTALLAT	ION .				_
DRILL	ING LOG	DIVISION		INSTALLAT		na Hv	y Dept.	SHEET 1 OF 1 SHEET	.
1. PROJECT				10. SIZE	AND TYPE	OF BIT 6	11		_
		20 Core	S	11. DATUM	FOR ELE	ATION SI	HOWN (TBM OR M	SL)	
2. LOCATION	(Coordinates or	Station)		12. MANU	FACTURER'S	DESIGNA	TION OF DRILL		\dashv
3. DRILLING	AGENCY		,						
_			T		NO. OF O		DISTURBED	UNDISTURBED	
4. HOLE NO.	(As shown on d	Irawing title	L-2	BOKDE	N SAMPLE	IARER			
5. NAME OF					NUMBER C				
0.0000000000000000000000000000000000000	05 UOL5			15. ELEVA	TION GROU		RTED	COMPLETED	_
6. DIRECTION VERTICAL		o	DEG. FROM VERT	16. DATE	HOLE	317		COMIT CENED	1
	OF OVERBURDE			17. ELEVA					\exists
	LLED INTO ROCK				CORE REC				
9. TOTAL DEF	TH OF HOLE 1.	1 feet		15. 310114	TORE OF II	ISI ECTOR			
		1	CLASSIFICATION OF MATERIAL	s	% CORE	BOX OF	3	REMARKS	
ELEVATION	DEPTH LEGEN	D	(Description)		% CORE RECOV- ERY	NO.	(Drilling times)	ne, water loss, depth o g, etc. if significant)	ıf.
0	0.0	Tine	grooved surfac	e					
ľ		HL in	cipient crack						
	-500	No ve	rtical extensi	.on	1				
	<u>-1</u> ;@:@								
	- 23.8	Ä							
	[p/Qo/	Ö			ŀ				
	- 2000	0			ļ				
		<u>\$</u>				ĺ			
	- 2000	2							_
	- 33	79 24							
		Š							
-1.1	1.1	EOB 1	.10-ft.		1				Γ
1	- · -	Flat	asphalt interf	ace					
		1.5-i	n. max size Ls	CA,					
			shed eous FA, natur	-21					
			gregation	a.i.					L
		Good	consolidation						L
			ntrained						\perp
		CID #	950624						\perp
		Ls CA	tend to be li	ghter					<u> </u>
		col	or w/no reacti	on					
		rim	S						<i>i</i> .
									1
									Ŀ
							1		_
									_
			•						_
	_								
	4								<u></u>
	_								<u> </u>
	4								-
	4								\vdash
	4								-
	4								-
	4								\vdash

Figure 2. Log of core 950624

									_
DRILLI	ING LOG	DIVISION		INSTALLATI		na Hw	y Dept.	SHEET 1 OF 1 SHEETS	
1. PROJECT		<u> </u>		10. SIZE	ND TYPE C	OF BIT 6	n		1
		20 Core	S	11. DATUM	FOR ELEV	ATION SH	OWN (TBM OR MS	SL)	7
2. LOCATION	(Coordinates or	, Station)		12. MANUF	ACTURER'S	DESIGNA	TION OF DRILL		-
3. DRILLING	AGENCY								_
4 HOLE NO.	(As shown on	drawing title		13. TOTAL BURDE	NO. OF O'N N SAMPLES		DISTURBED	UNDISTURBED	
and file n		arawing inte	L-3						4
5. NAME OF	DRILLER			14. TOTAL 15. ELEVAT					4
6. DIRECTION	OF HOLE						RTED	COMPLETED	┨
VERTICAL		o	DEG. FROM VERT	16. DATE	HOLE				
7. THICKNESS	OF OVERBURDS	N		17. ELEVAT			0.000140		7
8. DEPTH DRI	ILLED INTO ROCK	(18. TOTAL			R BURING		-
9. TOTAL DEP	TH OF HOLE 1	.15 feet							╛
C. C. L. T. Q. L	DEDTH LEGE	1	CLASSIFICATION OF MATERIAL	S	% CORE RECOV-	BOX OR SAMPLE	(Dailling tim	REMARKS	1
ELEVATION	DEPTH LEGEN	40	(Description)		ERY	NO.	weathering	e, water loss, depth of g, etc. if significant)	$oldsymbol{ol}}}}}}}}}}}}}}}}}$
0	0.0		grooved surfac	е					
	(200)	HL ir	cipient crack						L
	100								\vdash
		9							L
	a		at cast of re	bar	l I				
	- 8		ous incipient						-
	- 6 6 6		ctures upper 5-ft.						-
}	- 50		near 0.9-ft.						\vdash
	-								Η.
		2							\vdash
	-0.8	3 9							\vdash
-1.15	1.15		15-ft.						\vdash
			ılt interface .n. max size Ls	C7					
			n. Max Size is ished	CA,					
			eous FA, natur	al					
			gregation	·					
			consolidation entrained						
		1	950625						L
							1		L
			ient fractures ociated with						Ļ
			erous dark Ls	CA w/					F.
		rea	ction rims,						F
	-	par	ticles tend to	be					-
	-	fra	ctured						-
	-								\vdash
	-	1							
	-							2	
	-							•	
									<u></u>
									L
i	1 1	1			l	ı	1		1

Figure 3. Log of core 950625

DRILI	ING LO	G	DIVISION		INSTALLAT	юм ouisia	na	Hw	y Dept.		HEET F 1		
1. PROJECT					10. SIZE	AND TYPE	OF BIT	6	1			JAEEI	러
2. LOCATION	(Coordina		20 Core	S	11. DATU	FOR ELE	VATION	SH	OWN (TBM OR M	SL)			
2. EUCATION	(Coording	itez ot	sidilon)		12. MANU	FACTURER'S	DESI	GNAT	ION OF DRILL				\dashv
3. DRILLING	AGENCY				<u> </u>				North Page				_
4. HOLE NO.	(As show	n on d	rawing title			NO. OF O			DISTURBED	U	NDISTUR	BED	- 1
and file	number)		•	L-4									_
5. NAME OF	DRILLER					NUMBER C			S				
6. DIRECTION	OF HOLE	_			†			STAR	TED	COMP	LETED		\dashv
VERTICAL	□ INC	LINED	o	DEG. FROM VERT	16. DATE								
7. THICKNESS	S OF OVER	BURDEN	1			CORE REC			BODING				_
8. DEPTH DR	ILLED INTO	ROCK				TURE OF IN			DONING				\dashv
9. TOTAL DE	PTH OF HO	E 1.					,						_
ELEVATION	DEPTH	LEGEN		LASSIFICATION OF MATERIAL	S	% CORE RECOV- ERY	BOX	OR PLE	(Drilling tim	REMAR		denth o	,
	-	- 45		(Description)		ERY	NC).	(Drilling tim weathering	etc.	if sign	ificant)	`_
0	0.0_	800		grooved surfac	e								_
	_	Ser	g HL in	cipient crack		-							L
		್ಹಿಯ				1	1						\perp
	-	27.8	2			ļ							\vdash
	-	D000	g										-
				-in. steel bar									\vdash
	-	000	(ep	oxy coated) in	-								\vdash
		\$ ®	g crb	ient fracture			ļ						\vdash
	-		સ										\vdash
		v	2										\vdash
-1.1	1.10	, <u>, , , , , , , , , , , , , , , , , , </u>	FOR 1	.10-ft.									\vdash
-1.1	1			lt interface									-
	1 7		1.5-i	n. max size Ls	CA			ı					F
			1	shed eous FA, natur	- 7								
				gregation	aı			İ					
			Good	consolidation									
				ntrained									
			CID #	950626									L
			Incip	ient fractures									
			asso	ociated with la									-
				k Ls CA w/ reads, fractured	ction	J		- 1					-
	-			s, rractured		İ		- }					F
													\vdash
						ľ							
			1			Į							
	\neg		ĺ			ĺ							
		•										:	
						ŀ							L
	1					Ì							L
	_				-								\vdash
	_				I								\vdash
[4												-

Figure 4. Log of core 950626

										_
DRILL	ING LOG	DIVISION		INSTALLAT		na Hw	y Dept.	SHEET I	1 SHEETS	1
1. PROJECT				10. SIZE	AND TYPE	OF BIT 6	1		3116613	1
	I - (Coordinates or	20 Core	S	11. DATU	FOR ELEV	ATION SH	OWN (TBM OR M	SL)]
2. LOCATION	(Coordinates of	- Signon)		12. MANU	FACTURER'S	DESIGNAT	ION OF DRILL			1
3. DRILLING	AGENCY						Talas			
4 HOLE NO	(As shown on	drawing title			NO. OF O'		DISTURBED	UNDISTURB	ED	
and file r	umber)	didwing into	L-5							1
5. NAME OF	DRILLER				NUMBER C		S			-
6. DIRECTION	OF HOLF				TION GROU	STAF	RTED	COMPLETED		1
VERTICAL		o	DEG. FROM VERT	16. DATE	HOLE					
7. THICKNESS	OF OVERBURDE	N			TION TOP C					1
8. DEPTH DR	ILLED INTO ROCE	(CORE REC		R BURING		***	┨
9. TOTAL DEF	TH OF HOLE 1	.15 feet	:	1.0. 0.0						
S. C. (TIO)	05071 1505	,	CLASSIFICATION OF MATERIA	LS	% CORE RECOV- ERY	BOX OR SAMPLE NO.	(Dettiles No.	REMARKS	4	
ELEVATION	DEPTH LEGE	40	(Description)		ERY	NO.	weathering	e, water loss, g, etc. if signif	depth of ficant)	
0	0.0	Tine	grooved surface	ce						
					Į					
	<u>}</u>	2					İ			L
		9								_
	1806	Š.								
		<u> </u>					1			L
										L
	1000	28								L.
		8								Γ.
)								_
	6 a	É								_
-1.15	1.15	EOB 1	.15'		i					⊣.
			lt Interface							- .
	-			~						\vdash
		1.5-1	n max. size La shed	CA,						<u> </u>
	-		eous FA, natur	al						-
		No se	gregation							-
1	-		consolidation			0_			1	-
	-		entrained 950627							-
		CID #	930027						İ	\vdash
	-		•							1
	_									- ;
	-									- 1
	I - I									_
										\vdash
									-	
										Γ
	1								÷	
	7									Γ
									j	
									ļ	E
									ſ	Ĺ
									ſ	L
										i

Figure 5. Log of core 950627

DRILL	ING LOG	DIVISION		INSTALLAT.		ana	Hw	y Dept.	SHEET OF 1		
1. PROJECT			_	10. SIZE	AND TYPE	OF B	IT 61	r _		SHEETS	7
2 LOCATION	I - (Coordinates or	20 Core	S	11. DATU	M FOR ELE	OITAVE	N SH	OWN (TBM OR MS	SL)		
				12. MANU	FACTURER	S DES	IGNA	TION OF DRILL			7
3. DRILLING	AGENCY			13 TOTAL	. NO. OF (OVER_		DISTURBED	UNDISTUR	PEN	4
	(As shown on	drawing title	L-6		EN SAMPLE				0.10.0.0	.020	
5. NAME OF				14. TOTAL	NUMBER	CORE	BOXE	s			\dashv
				15. ELEVA	TION GROU	JND W	_				
6. DIRECTION VERTICAL		o	DEG. FROM VERT	16. DATE	HOLE		STAF	RIED	COMPLETED		
	S OF OVERBURDE			17. ELEVA	TION TOP	OF HO	LE		1		\exists
	ILLED INTO ROCK			18. TOTAL	CORE REC			BORING			4
9. TOTAL DE	PTH OF HOLE 1				TORE OF I	NSFEC	TOR				
ELEVATION	DEPTH LEGEN		LASSIFICATION OF MATERIAL (Description)	S	% CORE RECOV- ERY	BOX SAN	OR APLE O.	(Drilling time	REMARKS , water loss,	depth of	
	0 0 000	Wine		•	ERI	, N	···	Weathering	, etc. if sign	ificant)	+-
0	0.0		grooved surfactack pattern	е							-
	-000	Fract	ures generally								-
	-1.01	aro	und aggregate	•		1					\vdash
	10000	Some CA	fractures thro	ugn							
	_ 0,00										
	- 300	9									_
	000										-
-1.1	1.1	POR 1	.10-ft.								-
-1.1	1.1_		lt interface								卜.
		1.5-i	n. max size Ls	CA,		ļ			•		\vdash
			shed eous FA, natura	a l							
			gregation	a.			ĺ				
-		Good	consolidation								L
	4		ntrained 950628								-
	-	C1D #	730020								-
	-										<u> -</u>
	-										F
	-										-
	7										
	_										
	4										L
	4			ļ							L
	-				j					÷	⊢
	_										\vdash
1	-										H
ļ	-										H
ľ	7										F
ł											
											Į

DRILL	ING LOG	DIVISION		INSTALLAT		na Hw	y Dept.	SHEET 1	
1. PROJECT					AND TYPE			OF 1	SHEETS
		-20 Core	S	11. DATU	M FOR ELE	VATION SH	OWN (TBM OR M	(SL)	
2. LOCATION	(Coordinates o	or Station)							
3. DRILLING	ACENCY			12. MANU	FACTURER'S	S DESIGNAT	TION OF DRILL		
J. DRILLING	AGENCI			13. TOTAL	NO. OF C	VFR	DISTURBED	UNDISTURBED	
4. HOLE NO.	(As shown on	drawing title	7 7		EN SAMPLE			UNDISTORDED	
and file r			L-7						
5. NAME OF	DRILLER				NUMBER O		S		
6. DIRECTION	OF HOLE					STAF	TED	COMPLETED	
VERTICAL	INCLINE	o	DEG. FROM VERT	16. DATE	HOLE				
7. THICKNESS	S OF OVERBURD	EN		17. ELEVA	TION TOP	OF HOLE			
8. DEPTH DR	ILLED INTO ROC	K			CORE REC		BORING		
9. TOTAL DES	PTH OF HOLE]	1 feet		19. SIGNA	TURE OF II	NSPECTOR			
-			CLASSIFICATION OF MATERIA	LS	7 COPE	BOY OF	1	REMARKS	
ELEVATION	DEPTH LEGE		(Description)	_	% CORE RECOV- ERY	BOX OR SAMPLE NO.	(Drilling tin	ne, water loss, der g. etc. if significa	oth of
					ERT	NO.	weatherin	g, etc. if significa	nt)
0	0.0_8		grooved surface		1	1			_
			ace cracked to	0.1-					L
		g ft.			1				L
	أحدا_ ا	<u> </u>			1	1			
	600	**							
	.0	6 4				ļ			
	- 690	8				Ì			
•	1 7 8 8	669 500			İ				
		o ဝ				}			F.
		8				İ			F.
						İ			<u> </u>
-1.1	1.1		lt interface		1				\vdash
-1.1	⁺ · ⁺ -	1 5-i	n. max size Ls	CA		Ì			-
	l H		shed	,					-
	-	Silic	eous FA, natur	al	İ				-
	<u> </u>		gregation						<u></u>
		1	consolidation						-
	-		ntrained						<u> </u>
	_	CID #	950620						
		React	ion rims aroun	ď					L
			k CA						
		Near	surface voids	above					L
	·	CA							έ,
	_								<u> </u>
									F :
		- [
	7								
	1								
									. -
	7				ĺ				* -
	\dashv								
	-						•		-
	\dashv					ĺ			<u> </u>
	4								<u> </u>
	4								L
									L
									1

Figure 7. Log of core 950620

DRILL	ING LOG	DIVISION		INSTALLA		ana	Нω	y Dept.	SHEE		
1. PROJECT					AND TYPE				OF	1 SHE	ETS
		I-20 Core	S					OWN (TBM OR M	SL)		
2. LOCATION	(Coordinates	or Station)		40 1441	ELOTUDED	10.050	101111				
3. DRILLING	AGENCY			12. MANU	FACTURER	S DES	IGNA	TION OF DRILL			
0. 5	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,			13. TOTAL	. NO. OF	OVER-		DISTURBED	UND	STURBED	-
		n drawing title	L-8	BURD	EN SAMPLI	ES TAK	EN				
5. NAME OF		•		14. TOTAL	NUMBER	CORE	BOXE	s			\dashv
	JIIILLEII				TION GRO						\dashv
6. DIRECTION				16. DATE	HOLE		STAR	RTED	COMPLET	ED	
VERTICAL	□ INCLINE	D 0	DEG. FROM VERT								
	S OF OVERBUR			17. ELEVA				RORING			\dashv
	ILLED INTO RO				TURE OF			Codinio			-
9. TOTAL DE	PTH OF HOLE	1.1 feet									
ELEVATION	DEPTH LEG	END	CLASSIFICATION OF MATERIAL	S	% CORE RECOV- ERY	BOX	OR IPLE 0.	(D-11)	REMARKS		
ELEVATION	DEF III	END	(Description)		ERY	N	ö.	(Drilling tim weathering	e, water i , etc. if s	oss, depth significant)	of
0	0.0	Tine	grooved surfac	e							
	789	Numer	ous incipient								
		V-4-4	ctures near su	rface		1					
		70° 0.2	:-ft								
		· · · · · · · · · · · · · · · · · · ·			1						
	1 -0	69									
	280										H
	- 0					1					\vdash
		50									-
		8									-
	- Bat	66 6			l						-
-1.1	1.1	EOB 1	.10-ft.								\vdash
		Aspha	lt interface								-
			n. max size Ls	CA,			ľ				一.
			shed	_ •		ļ					F
			eous FA, natur gregation	aı		İ					
			consolidation								
			ntrained								
		CTD #	950619				j				
		37		•		ļ					
-			ous reaction r: CA, fractures a			Ì					
	7		ntiful in some								
	7		reaction rims								Γ.
1	7										
l	7										\vdash
i				[
ł											
ĺ	Ħ										F
ľ	7			1			l				
ļ	7	1									⁷
ĺ	\neg										
	-										H
	-										-
	+			}							
	\dashv										\vdash
	\dashv			-							
1	-										-

Figure 8. Log of core 950619

DRILL	ING LOG	; ^D	IVISION		INSTALLAT		na Hw	y Dept.	SHEET 1	7
1. PROJECT							OF BIT 6		OF 1 SHEETS	┨
	7- "		0 Core	5	11. DATUA	FOR ELE	VATION SH	OWN (TBM OR M	SL)	1
2. LOCATION	(Coordinal	ies or 3	ranon)		12. MANU	FACTURER'S	DESIGNAT	ION OF DRILL		-
3. DRILLING	AGENCY									
4. HOLE NO.	(Ac chaws	on dra	wing title			NO. OF O		DISTURBED	UNDISTURBED	1
and file n		i on are	wing into	L-9						_
5. NAME OF	DRILLER				14. TOTAL			S]
6. DIRECTION	OF HOLE				15. ELEVA		STAR	TED	COMPLETED	┨
VERTICAL	□ INCL	LINED E		DEG. FROM VERT	16. DATE	HOLE				1
7. THICKNESS	OF OYERE	BURDEN			17. ELEVA			2.000112		1
8. DEPTH DRI					18. TOTAL			BORING		-
9. TOTAL DEF	TH OF HOL	또 0.2	feet							
ELEVATION	DEPTH	LEGEND	c	LASSIFICATION OF MATERIAL	S	% CORE RECOV- ERY	BOX OR SAMPLE	(Datition at a	REMARKS	1
LLEVATION	OEI III	CEGEINE		(Description)		ERY	NO.	weathering	ie, water loss, depth of g, etc. if significant)	
0	0.0_3	IF 7I	Rubbl	е						
	R	U Z								L
-0.2	0.2_		EOB							L
		.	Aspna	lt interface n. max size Ls	CA					L
	. —			shed	CA1,					L
	-			eous FA, natur	al					_
	-			ntrained ion rims on CA						- .
				erved						Η.
		ĺ		CA are fractur	ed					- ·
			CTD #	950617						
	1	Ì								\vdash
			•							\vdash
	7									\vdash
	4									
	4									
	-									_
		1								
Ī	4									_
	4									
	-						İ			-
	\dashv						ļ			_
	-	}					İ			
	. –]		i	_
i	7					i	1			_
	7					ļ			. 1	_
1						İ			· •	_
ĺ				•	}					
ŀ		1			ł	1	ļ		İ	_
j	\dashv					j			Ţ	_
		-					ļ			_
	\perp					-				
	4									_

Figure 9. Log of core 950617

DRILL	ING LOG	DIVISION		INSTALLAT		na Hw	y Dept.	SHEET OF]	1	П
1. PROJECT				10. SIZE	AND TYPE	OF BIT 6	н		SHEETS	4
0 100171011	(Coordinates of	-20 Core	S	11. DATU	M FOR ELE	VATION SH	OWN (TBM OR M	SL)		7
2. LUCATION	(Coordinates t	or sidilon)		12. MANU	FACTURER'S	DESIGNA	TION OF DRILL			-
3. DRILLING	AGENCY									╝
4 HOLE NO	(As shown on	drawing title		-	NO. OF O		DISTURBED	UNDISTU	RBED	7
and file r		Cidwing fille	L-10	BOND	IN SAMPLE.	JIANEN				
5. NAME OF	DRILLER				NUMBER (]
6. DIRECTION	OF HOLE			15. ELEVA	TION GROU		RTED	COMPLETED		-
VERTICAL		0	DEG. FROM VERT	16. DATE	HOLE					
7. THICKNESS	OF OVERBURD	EN			TION TOP			<u> </u>		_
8. DEPTH DR	ILLED INTO ROC	K			CORE REC		R BORING			_
9. TOTAL DEF	PTH OF HOLE (.9 feet		19. SIGNA	TURE OF IT	ASPECTOR				
			CLASSIFICATION OF MATERIA	LS	% CORE	BOX OR		REMARKS		1
ELEVATION	DEPTH LEGE	ND	(Description)		% CORE RECOV- ERY	BOX OR SAMPLE NO.	(Drilling tim	e, water loss , etc. if sign	, depth of	1
0	0.0	Finis	hed top surfac	e						\top
		8	•							一
	1 78.5	o				ľ				\vdash
	00	Incip	ient fracture							1
	7 60	39			İ					
	600	8								
		d								\vdash
	200	2 0								
										上
-0.9	0.9	EOB 0	.9-ft							Γ
			lt surface							
		1.5-1	n maximum size crushed (most	: LS 1v:1-						L
ĺ			and smaller)	-y -						
			eous FA, natur	al						-
			gregration							-
	-		consolidation ntrained							L
	-	1	950614							H
	-		V							-
- 1	\dashv		ous reaction r							-
i			CA, some aggre fractured w/c							\vdash
	\dashv		ending into pa							\vdash
Ī	7				-					-
i	1				İ					F
- 1	7									
ľ										
	7				- [
]								÷	Γ
]				Γ
1					Ì	İ				
	.]					.				
				1		ĺ				
				ĺ	1					
				İ	1	İ				
İ										L
		1								1

Figure 10. Log of core 950614

DRILL	ING LOG	DIV	VISION		INSTALLATI		na	Hw	Dept.	SH		1	7
1. PROJECT	·				10. SIZE					T OF		SHEETS	┨
			Cores	<u> </u>					OWN (TBM OR MS	L)			7
2. LOCATION	(Coordinates	or Sta	ation)		12 MANUI	ACTURER'S	DES	IGNAT	ION OF DRILL				-1
3. DRILLING	AGENCY				12								
					13. TOTAL				DISTURBED	UN	DISTURE	BED	7
4. HOLE NO.	(As shown o	n draw	ving title	L-11	BURDE	N SAMPLES	SIAK	EN					
5. NAME OF			1		14. TOTAL	NUMBER C	ORE	BOXE	5				7
					15. ELEVA	ION GROU	ND W		TED	00000	-]
6. DIRECTION VERTICAL		FD []		DEG. FROM VERT	16. DATE	HOLE		STAR	IEU	COMPL	FIED		
	OF OVERBUR				17. ELEVA	ION TOP	OF HO	LE					\dashv
	ILLED INTO RO				18. TOTAL				BORING]
	TH OF HOLE		er		19. SIGNAT	TURE OF IN	(SPEC	TOR					1
				LASSIFICATION OF MATERIAL	S	% CORE	80)	OR		REMARK	S		┨
ELEVATION	DEPTH LEG	SEND		(Description)		% CORE RECOV- ERY	SAN	OR IPLE O.	(Drilling time weathering	, water	loss,	depth of	
0	0.0	20	Tipe	surface								,	1
		000											
		8	Incip	ient fracture									
	~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~	0.00											
	10°C		Incip	ient fracture									
	70	20											
		ğ											
													Γ
		O.Q											
-1	1.0_		EOB 1										L
				lt interface	-								
				maximum size L shed	s CA,								L,
				eous FA, natur	al								L
				gregation									
				consolidation									L
				ntrained 950616									L
	_		CID #:	320010									L
			Numero	ous reaction r	ims								L
			on (	CA, some aggre	gate								ļ.
				fractured w/c ending into pa									-
			GYC	anding into pa	ale.								-
	-												F
	-					•							$\vdash$
													$\vdash$
	-												-
	$\dashv$												-
İ													$\vdash$
												•	
	_												
	$\dashv$												$\vdash$
	-												<b> </b>
	-												$\vdash$
	7												F
	$\dashv$					ĺ		-					$\vdash$

Figure 11. Log of core 950616

DRILLING LOG DIVISION					INSTALLATION SHEET 1 Louisiana Hwy Dept. OF 1 SHEETS							
1. PROJECT I-20 Cores					10. SIZE AND TYPE OF BIT 6"							
	(Coordinates of	11. DATUM FOR ELEVATION SHOWN (TBM OR MSL)										
2. LUCATION	(Coordinales (	y Signon)		12. MANU	FACTURER'	S DESI	GNAT	TION OF DRILL				
3. DRILLING	AGENCY											
4. HOLE NO.	(As shown on	13. TOTAL NO. OF OVER- DISTURBED UNDISTURBED BURDEN SAMPLES TAKEN										
and file	14. TOTAL NUMBER CORE BOXES											
5. NAME OF	DRILLER			15. ELEVA				2			-	
6. DIRECTION	OF HOLE			16. DATE			_	RTED	COMPLETE	D	$\dashv$	
VERTICAL			DEG. FROM VERT			25 1121	_					
	OF OVERBURD			17. ELEVATION TOP OF HOLE  18. TOTAL CORE RECOVERY FOR BORING								
	PTH OF HOLE O			19. SIGNA	TURE OF I	NSPECT	OR				$\neg$	
S. IOIAL DE	I I I		CLASSIFICATION OF MATERIA	LS	7 COPE	eov	OP		REMARKS			
ELEVATION	DEPTH LEGE		(Description)	_	% CORE RECOV- ERY	SAMI NO	PLE	(Drilling tim	iling time, water loss, depth of eathering, etc. if significant)			
0	0.0	Ba Finis	hed surface					Weatherin	g, etc. if si	gnificant)	-	
		8 111112	med surface								- }-	-
		Ö				1					H	-
		8									h	
		30			İ						F	~
		6										_
		36				1						_
	- 000	è										_
		000										_
-0.9	0.9		.9-ft								-	
	-	1-in	lt interface maximum size L	s CA.			ĺ				-	_
	-	cru	shed				- 1				-	-
			eous FA, natur gregation	al							  -	-
			consolidation								上	-
			ntrained									
		CID #	950622									_
	4	Few d	ark pieces of	CA w/							L	_
	-	rea	ction rims, mo	stly			- 1				-	
ļ	-	lig	ht color Ls pi	eces							-	_
İ	-										$\vdash$	-
[	7										$\vdash$	-
İ											上	
							-					
				-	İ							
	4	İ									L	
	4			ŀ			- [				÷	
				ļ							_	_
-	4										$\vdash$	
1	$\dashv$										$\vdash$	
- 1	7										$\vdash$	
1	7										H	
Ì											<b> </b>	
		1			1							

Figure 12. Log of core 950622

DRILLING LOG DIVISION					INSTALLATION Louisiana Hwy Dept.  SHEET 1 OF 1 SHEETS								
1. PROJECT					10. SIZE AND TYPE OF BIT 6"								
I-20 Cores 2. LOCATION (Coordinates or Station)					11. DATUM FOR ELEVATION SHOWN (TBM OR MSL)								
2. LOCATION	(Coordinates of	- Station)		12. MANUI	FACTURER'S	DESIGNAT	ION OF DRILL	· · · · · · · · · · · · · · · · · · ·	$\dashv$				
3. DRILLING AGENCY									_  •				
A HOLE NO	(As shown on	drawing title		13. TOTAL NO. OF OVER- DISTURBED UNDISTURBED  BURDEN SAMPLES TAKEN									
and file r	number)		L-13										
5. NAME OF	DRILLER			14. TOTAL 15. ELEVA					4				
6. DIRECTION	OF HOLE .					STAF		COMPLETED	┪				
VERTICAL	□ INCLINED	o	DEG. FROM VERT	16. DATE					╛				
7. THICKNESS	OF OVERBURDE	N		17. ELEVATION TOP OF HOLE 18. TOTAL CORE RECOVERY FOR BORING									
	ILLED INTO ROCK			19. SIGNA			COMING		$\dashv$				
9. TOTAL DEF	TH OF HOLE ()			İ			,		┙				
ELEVATION	DEPTH LEGER		CLASSIFICATION OF MATERIAL	LS	% CORE RECOV-	BOX OR SAMPLE	(Drilling tim	REMARKS	.				
	30- 0		(Description)		ERY	NO.	weathering	ne, water loss, depth of g, etc. if significant)	4_				
0	0.0_		surface						_				
		incip	pient fractures rough out	}	[				$\vdash$				
	_000	2	ough out			}			-				
	- 800	0			1				-				
		<u>\$</u>							-				
		.0 .0							_				
	- POS	20							$\vdash$				
	<b>−</b> 0°%	8							<b> </b>				
-0.9	0.9	EOB C	).9-ft			ĺ			上				
	0.5	New h	reak			}		•					
			n maximum size	Ls					Г				
			crushed ceous FA, natur	al .					Ε.				
			gregation	<b>41</b>					L.				
			consolidation						<u> </u>				
		2.	Intrained 950618						<b> </b>				
	-	012 "	330010						$\vdash$				
	-		ous reaction r		-				$\vdash$				
	-	on	CA, some aggre fractured w/c	gates					+				
	_		ending into pa						$\vdash$				
			-						下.				
									-				
	<u> </u>								L				
									$\vdash$				
	_								_				
	_							:	-				
									-				
	4								-				
	-								-				
	-								$\vdash$				
	+								$\vdash$				
									-				
		ı							上				

Figure 13. Log of core 950618

			· · · · · · · · · · · · · · · · · · ·									
DRILL	ING LOG	DIVISION		INSTALLAT	SHEET	1	$\neg$					
1. PROJECT				Louisiana Hwy Dept. OF 1 SHEETS								
		I-20 Core	S	11. DATUM FOR ELEVATION SHOWN (TBM OR MSL)								
2. LOCATION	(Coordinates	or Station)		10 111111	C) OTHERS	DECICNA	TION OF DRILL			_		
3. DRILLING	AGENCY			12. MANU	PACIURERS	DESIGNA	ION OF BRILL					
				13. TOTAL NO. OF OVER- DISTURBED UNDISTURBED								
4. HOLE NO.		on drawing title	L-14	BURDE	N SAMPLES	S TAKEN				- 1		
5. NAME OF				14. TOTAL	NUMBER C	ORE BOXE	s			$\dashv$		
				15. ELEVA	TION GROU	ND WATER				_		
6. DIRECTION VERTICAL		ED 🗆	DEG. FROM VERT	16. DATE HOLE STARTED COMPLETED								
	S OF OVERBUR		DEG. FROM VERT	17. ELEVA	TION TOP (	OF HOLE				$\dashv$		
	ILLED INTO RO				CORE REC		BORING	•		7		
	PTH OF HOLE		· · · · · · · · · · · · · · · · ·	19. SIGNA	TURE OF IN	ISPECTOR				7		
3. TOTAL DEF	TH OF HOLE		CLASSIFICATION OF MATERIAL	15	~ coor	L nov. on	1	REMARKS		-		
ELEVATION	DEPTH LEG	GENO	(Description)		% CORE RECOV- ERY	BOX OR SAMPLE NO.	(Drilling tim	ne, water loss, g, etc. if sign	, depth of ificant)	,		
0	0.0_0	Tine	surface									
	D2	90-06 10-06				1						
'		೧.ಕ			ĺ							
	Pa	8										
		486										
	0	20								$\vdash$		
	200	<b>3</b>										
	100											
	1000	<b>4</b> 6										
-1	1.0_	EOB 1	.0-ft							$\Gamma$		
			lt interface			,						
			maximum size L shed	s CA,								
			eous FA, natur	al	-					L		
		No se	gregation									
	4		consolidation							_		
	_		ntrained 950621							$\perp$		
	4	( C1D #	950021		İ	Ī				L		
	4	Mostl	y light colore	d Ls		l				$\perp$		
	$\dashv$	CA								$\vdash$		
	4		incipient fractories	tures		l				_		
Ì	-		iated w/ dark 1	r.s	ì	1						
	4		cles w/reaction		- 1					$\vdash$		
	4	rims	and fractures							$\vdash$		
				1						<u> </u>		
	4						•			-		
	-	Ì			1	ĺ				-		
1	-				-					$\vdash$		
	$\dashv$				1	-				+		
	$\dashv$									-		
- 1	$\dashv$				-					$\vdash$		
	$\dashv$									$\vdash$		
	4									-		
	$\dashv$									<b>H</b>		
										-		
						1				$\vdash$		

								_		$\overline{}$			_
DRILLING LOG DIVISION				INSTALLATION SHEET 1 Louisiana Hwy Dept. OF 1 SHEETS									
1. PROJECT					10. SIZE AND TYPE OF BIT								
I-20 Cores				11. DATUM FOR ELEVATION SHOWN (TBM OR MSL)									
2. LOCATION (Coordinates or Station)				12. MANUFACTURER'S DESIGNATION OF DRILL									
3. DRILLING AGENCY													
4. HOLE NO.	(An abaum	an dear	vina title		13. TOTAL NO. OF OVER- DISTURBED UNDISTURBED BURDEN SAMPLES TAKEN								
and file n		on ara	anig iino	L-15	BURDEN SAMPLES TAKEN								╛
5. NAME OF	DRILLER				14. TOTAL NUMBER CORE BOXES								4
6. DIRECTION	OF HOLE				15. ELEVATION GROUND WATER STARTED COMPLETED								-
VERTICAL		NED 🗆		DEG. FROM VERT	16. DATE HOLE								
7. THICKNESS	OF OVERB	URDEN			17. ELEVATION TOP OF HOLE								1
8. DEPTH DRI	LLED INTO	ROCK			18. TOTAL			_	BORING				4
9. TOTAL DEP	TH OF HOL	£ 0.9	feet		19. SIGNAL	UKE OF IF	ISPECIA	OK					
			С	LASSIFICATION OF MATERIAL	s	% CORE	вох	OR		REMARKS			7
ELEVATION	DEPTH L	EGEND.		(Description)		% CORE RECOV- ERY	BOX SAMP NO.		(Drilling time weathering,	, water i , etc. if s	ignific	epth of cant)	
0	0.0	8980 a	Finis	hed surface									1
ŭ													F
	- A	80											
		000											
		G000											
		8 8											
	- <b>C</b>	86.9											
		200											
													_
-0.9	0.9			0.9-ft			ļ	- 1					
			Asph	alt interface			İ						
				in maximum siz	e Ls								Γ
				, crushed ceous FA, natu	ral			-					Γ.
				egregation	141								T .
				consolidation					•				
				entrained				1					
ļ			CTD	#950615									
			Some	reaction rims	on								
				, mostly light	0								
			CO	lored CA parti	cles,								L
]	4			rker pieces te small	nd to								L
	_		be	Small									Ŀ.
	4												F :
		İ											<u></u>
	-												<u> </u>
	-												<u> </u>
	-												_
	-											÷	<u> </u>
	$\dashv$							- }					<u> </u>
	$\dashv$				ļ								H
1	۲.				]								-
	┥.												-
l	. $\dashv$												H
	$\dashv$												<u> </u>
													-

Figure 15. Log of core 950615.

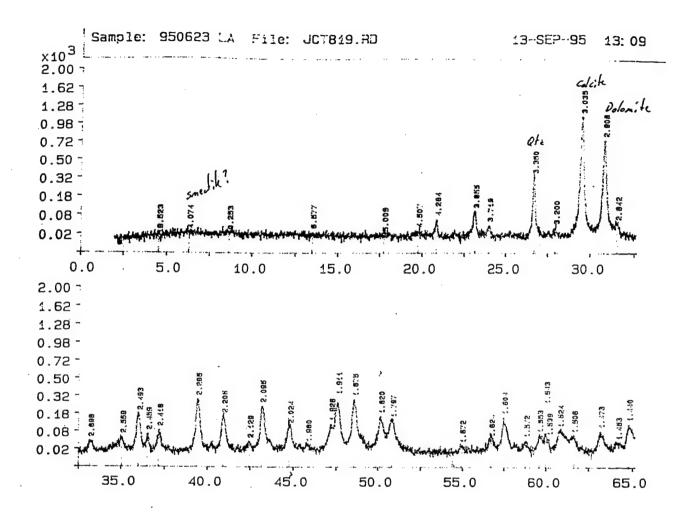


Figure 16. X-ray diffraction pattern of reactive coarse-aggregate particle from core 950623

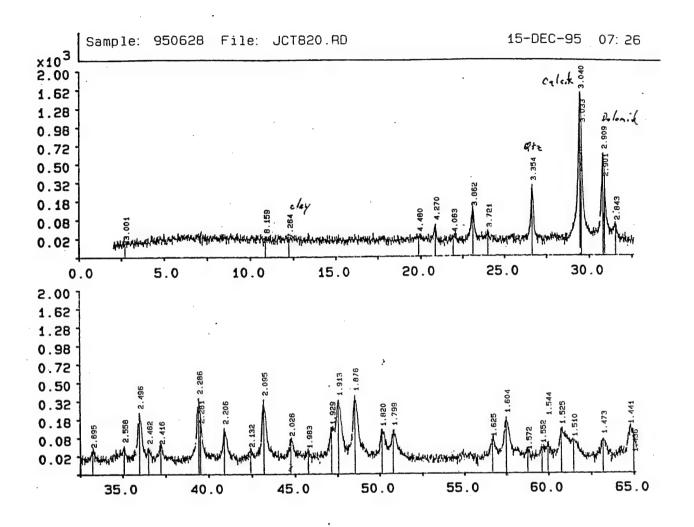


Figure 17. X-ray diffraction pattern of reactive coarse-aggregate particle from core 950628

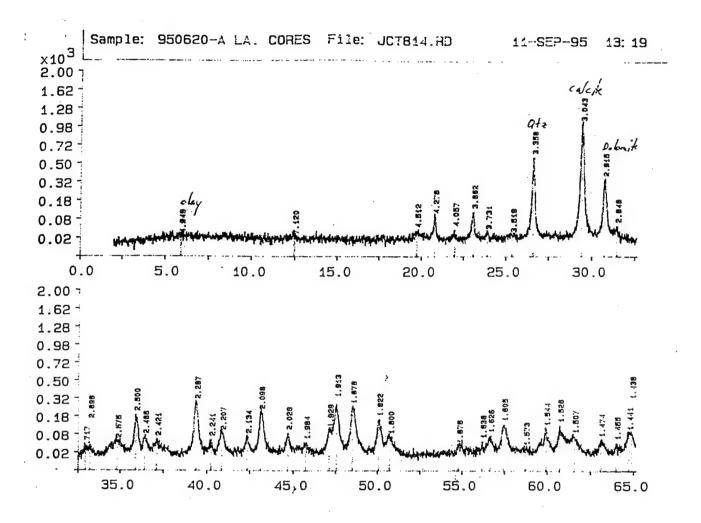


Figure 18. X-ray diffraction pattern of reactive coarse-aggregate particle #A from core 950620

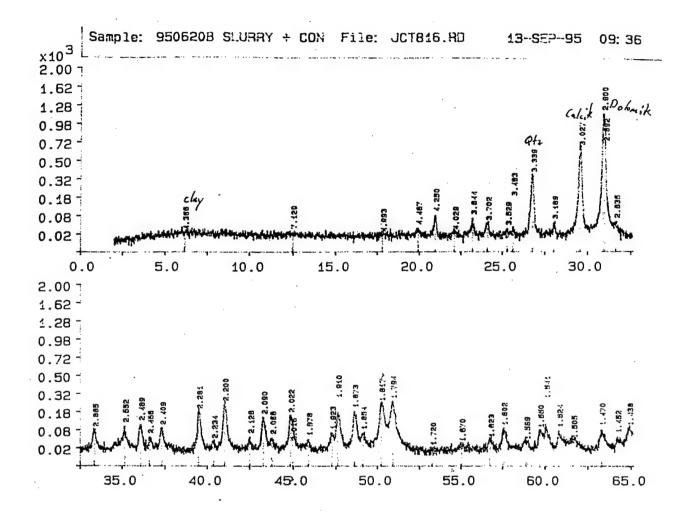


Figure 19. X-ray diffraction pattern of reactive coarse-aggregate particle #B from core 950620.

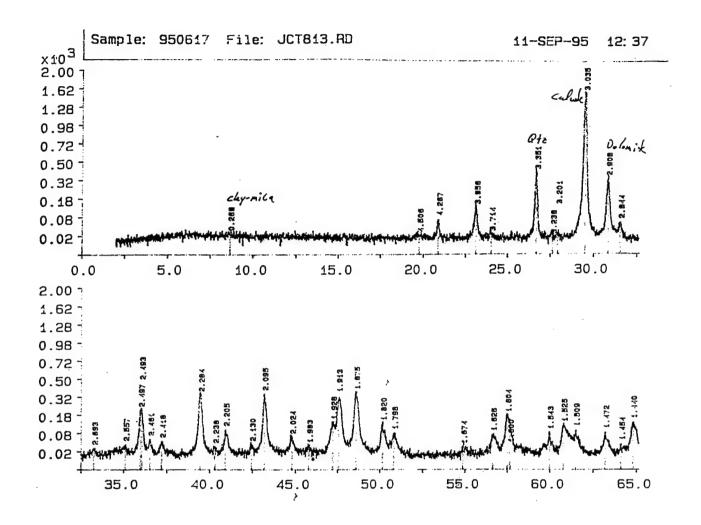


Figure 20. X-ray diffraction pattern of reactive coarse-aggregate particle from core 950617

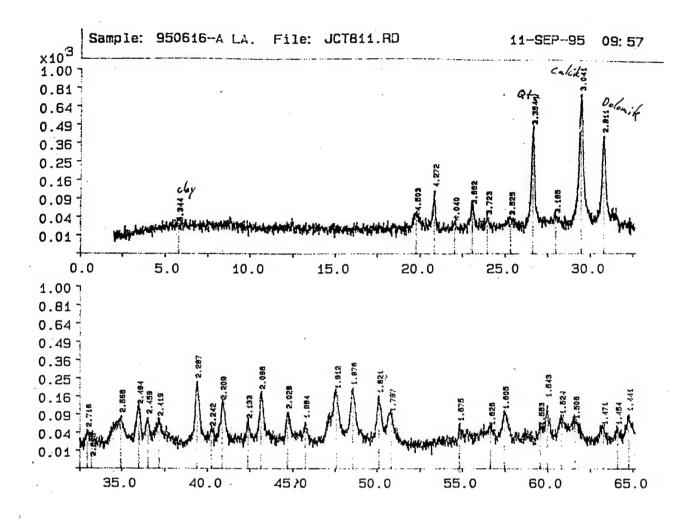


Figure 21. X-ray diffraction pattern of reactive coarse-aggregate particle #A from core 950616

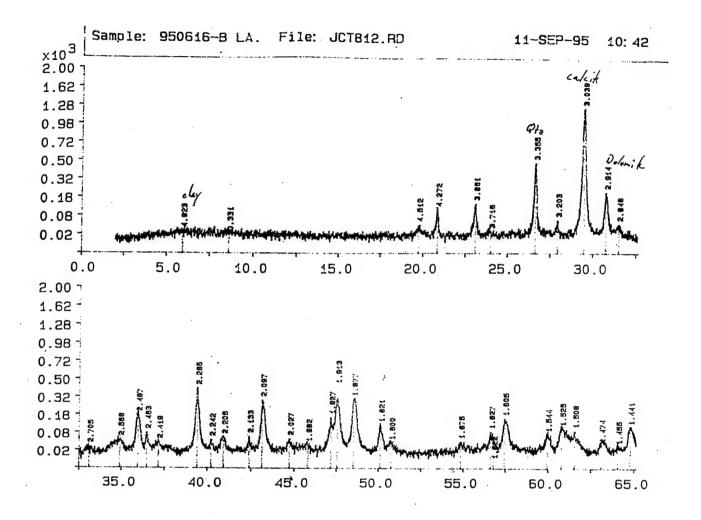


Figure 22. X-ray diffraction pattern of reactive coarse-aggregate particle #B from core 950616

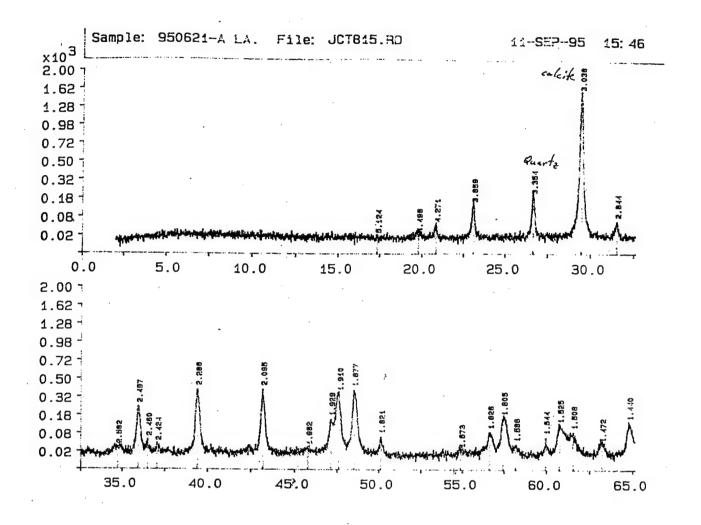


Figure 23. X-ray diffraction pattern of non-expansive reactive coarse-aggregate particle #A from core 950621

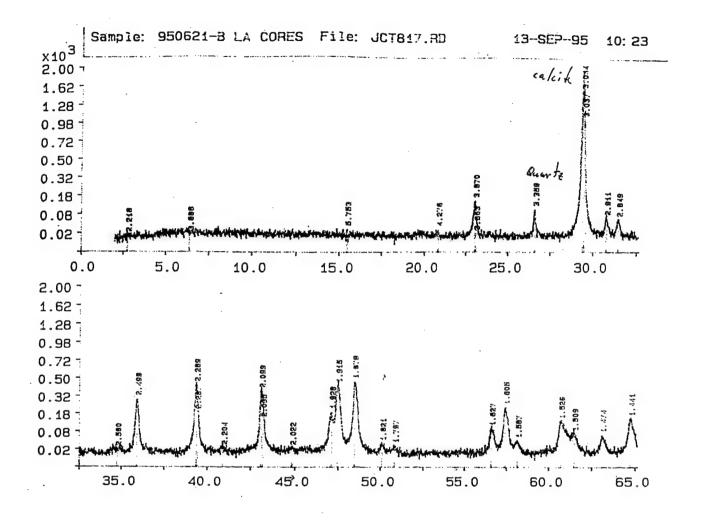


Figure 24. X-ray diffraction pattern of non-expansive reactive coarse-aggregate particle #B from core 950621

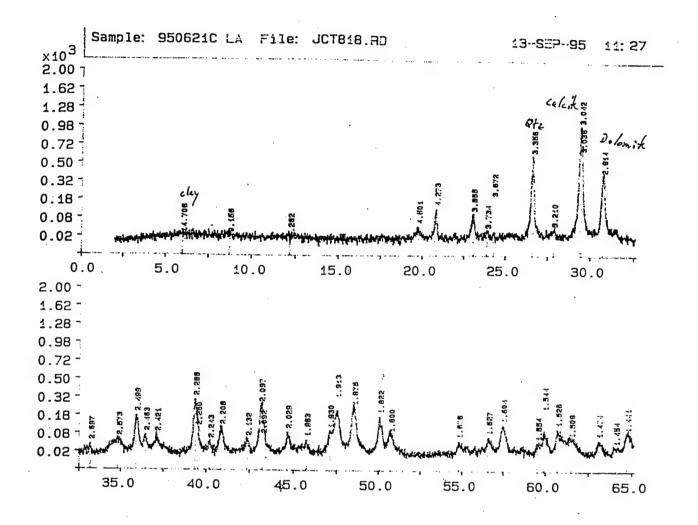


Figure 25. X-ray diffraction pattern of expansive reactive coarse-aggregate particle #C from core 950621

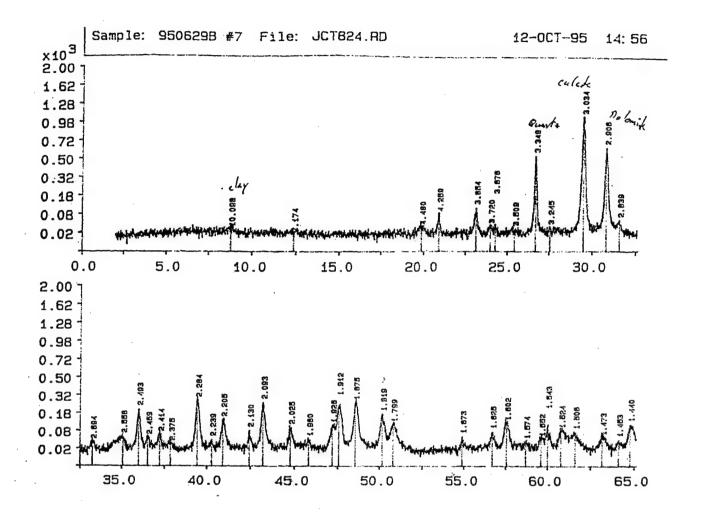


Figure 26. X-ray diffraction pattern of highly reactive coarse-aggregate particle #B from limestone sample 950629 after treatment in sodium hydroxide

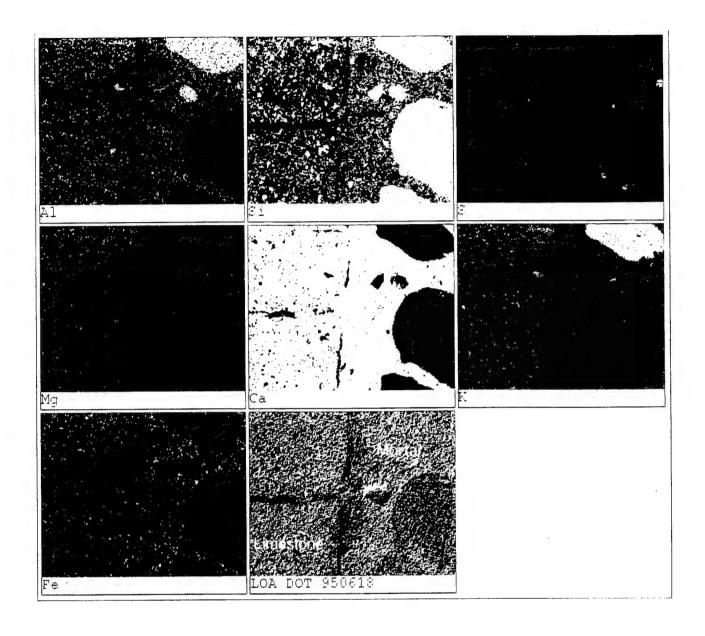


Figure 27. High-resolution X-ray elemental map of reactive coarse aggregate interface with paste. No migration of elements is observed

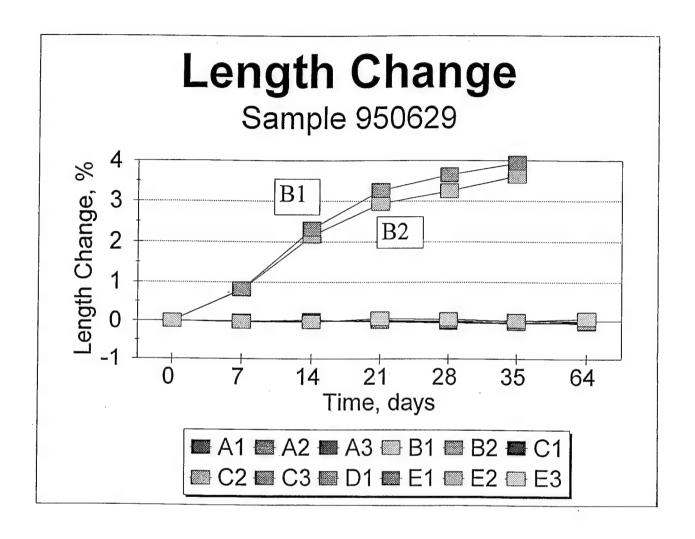


Figure 28. Rock cylinder test shows two specimens (B1 and B2) from sample 950629 expanding quickly while others did not expand. Cores were taken from five particles (A, B, C, D, and E) representing varieties of rock

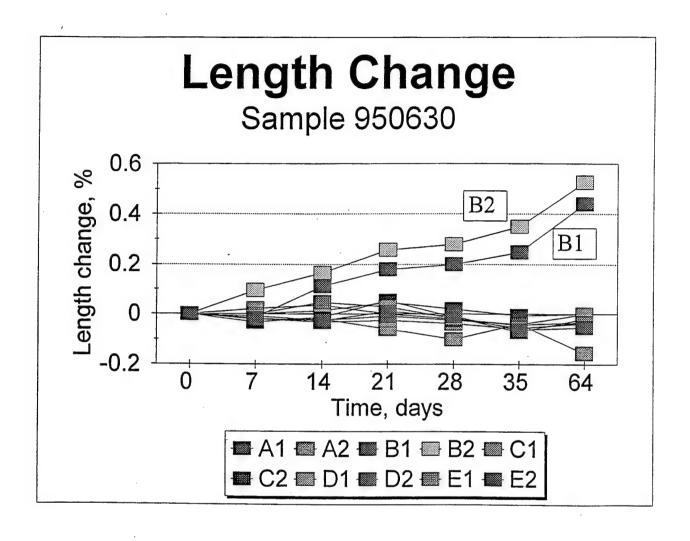


Figure 29. Rock cylinder test shows two specimens (B1 and B2) from sample 950630 expanding while others did not expand. Cores were taken from five particles (A, B, C, D, and E) representing varieties of rock

Table 1 Information of I-20 Cores and Aggregate Samples Near Monroe, LA										
Item	CTD Serial No.	DOTD Core No.	Location	Degree of Cracking						
Westbo	ound land west o	of Monroe, show	ring little distress; log miles begin at Lincoln PL westward							
1	950623	1	Log mile 1.5, shoulder	very fine, hairline						
2 950624 2 Log mile 3.1, outside land outside wheel path hairling										
	und lane west of ss eastward	Monroe, showi	ng major distress with cracks at joints raveling; log mile be	gins at LA 145						
3	960625	3	Log mile 1.5, outside lane, edge	surface cracks						
4	950626	4	Log mile 3.38, outside land outside wheel path	cracks near joint						
5	950627	5	Log mile ?, outside lane outside wheel path	no cracks surface						
6	950628	6	Log mile 4.7, outside lane outside wheel path	heavy cracking						
Aggreg	Aggregates used in construction of I-20									
7	950629	limestone	TL James (451-05060, I-20 west of Monroe) Dravo, Smithland, KY							
8	950630	limestone	Bud Hale (451-07-29, I-20 east of Monroe), Denton Contractor, Dravo, Smithland, KY							
9	950631	sand	Denton Contractor (451-07-29 & 28)							
	und lane east of ction mile post 1		ng major distress; repairs required to prevent raveling; log m	nile begins at Delhi						
10	950620	7	Log mile 1.58 outside lane outside wheel path	cracking						
11	950619	8	Log mile 1.7 outside lane outside wheel path	cracking						
12	960617	9	Log mile 1.79 outside land outside wheel path	heavy cracking						
13	950614	10	Log mile 1.79 shoulder	cracked						
14	950616	11	Log mile 2.38 outside lane	light cracking						
15	950622	12	Log mile 2.38 shoulder	no cracks						
16	950618	13	Log mile 3.7 edge	heavy cracking						
Westbo	ound lane east of	Monroe showir	ng little distress; log mile begins at mile post 157 westward							
17	950621	14	Log mile 0.10 outside lane outside wheel path	very light crack						
18	950615	15	Log mile 0.10 shoulder	no crack						

II .	Table 2 Evaluation Matrix										
Item	CTD Serial No.	DOTD Core No.	Pulse Velocity	Petrographic Examination	X-ray Diffraction	Expansion	Cement Content				
1	950623	1	~	V	V		V				
2	950624	2	~								
3	950625	3		~		~					
4	950626	4	~	~		V	V				
5	950627	5	~	V							
6	950628	6	V	~	~						
7	950629	limestone		V							
8	950630	limestone		~							
9	950631	sand									
10	950620	7	V	~	~						
11	950619	8	~	~							
12	950617	9		V			V				
13	950614	10	V								
14	950616	11	~	V	V						
15	950622	12	~	V							
16	950621	13		V							
17	950621	14	V	~	~		V				

Table 3 Pulse Velocity Data										
Specimen ID	Length, in. (mm)	Diameter, in. (mm)	Time, µsec	Velocity, ft/sec (N)						
950623	10.625 (270)	6 (152)	59.0	15,000 (66,723)						
950626 ¹	12.000 (305)	6 (152)	94.3	10,600 (47,151)						
950627	12.063 (306)	6 (152)	69.1	14,550 (64,721)						
950628 ¹	12.313 (313)	6 (152)	135.7	7,560 (33,629)						
950620	10.875 (276)	6 (152)	77.8	11,650 (51,821)						
950614	10.625 (270)	6 (152)	73.7	12,010 (53,423)						
950619	10.625 (270)	6 (152)	74.6	11,870 (52,800)						
950616	10.625 (270)	6 (152)	67.4	13,140 (58,800)						
950622	9.688 (246)	6 (152)	53.8	15,040 (66,901)						
950621	10.938 (278)	6 (152)	58.9	15,470 (68,814)						
950615	9.625 (244)	6 (152)	53.0	15,130 (67,302)						
1 Specimens were	cracked.									

Table 4 Result of Cement-Content Analysis											
		Sample No.									
Property	950623	950626	950617	950621							
Combined Water, %	2.32	. 1.69	2.36	2.25							
Insoluble Residue, %	86.20	87.41	86.33	81.53							
Free Water, %	4.67	4.13	5.28	3.62							
Density, lb/ft ³	148.6 (2,380)	149.2 (2,390)	148.6 (2,380)	145.5 (2,331)							
Cement Content, lb/yd3	438 (260)	420 (249)	430 (255)	613 (364)							

# Appendix A Photographs of Concrete Sections

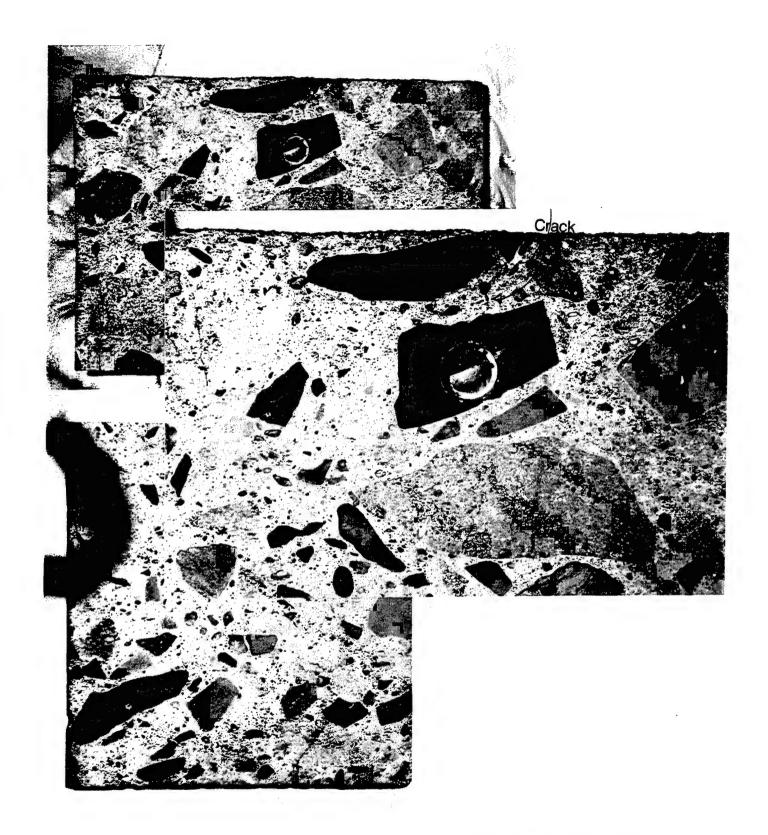


Figure A1. Sample 950623 shows reactive particles 1 and 2 near top surface associated with cracks. The top and bottom samples are 6 in. (152 mm) left to right

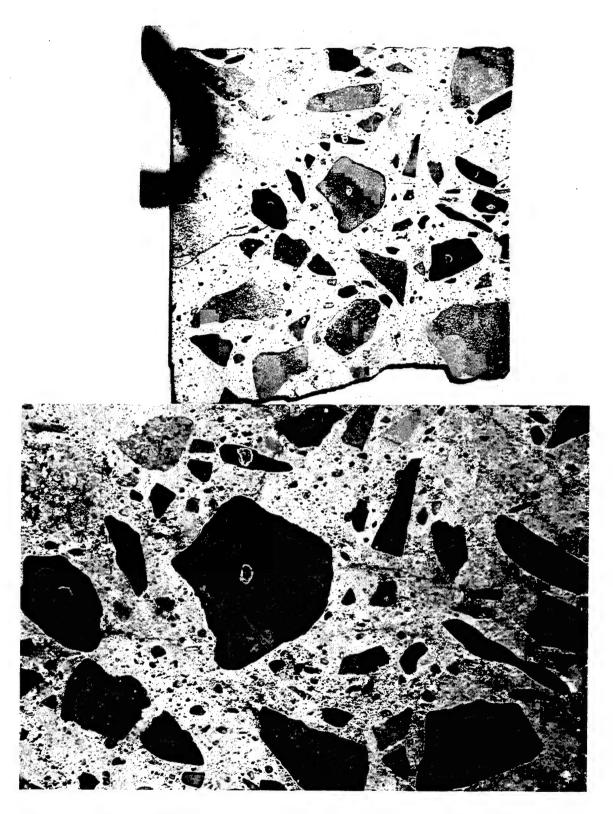


Figure A2. Sample 950623 shows a random crack pattern with cracks propagating from central reactive coarse aggregate. Other reactive aggregate particles are also present. Top sample is 6 in. (152 mm) left to right

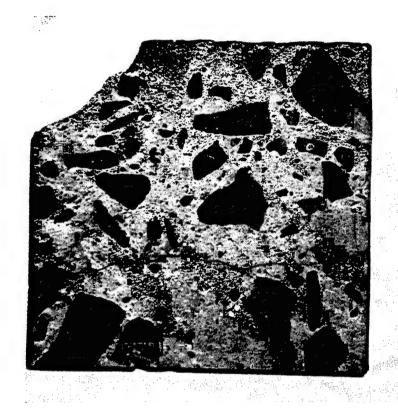


Figure A3a. Sample 950626 shows some interior cracking in the concrete and a few small reactive particles with reaction rims. The sample is 6 in. (152 mm) left to right

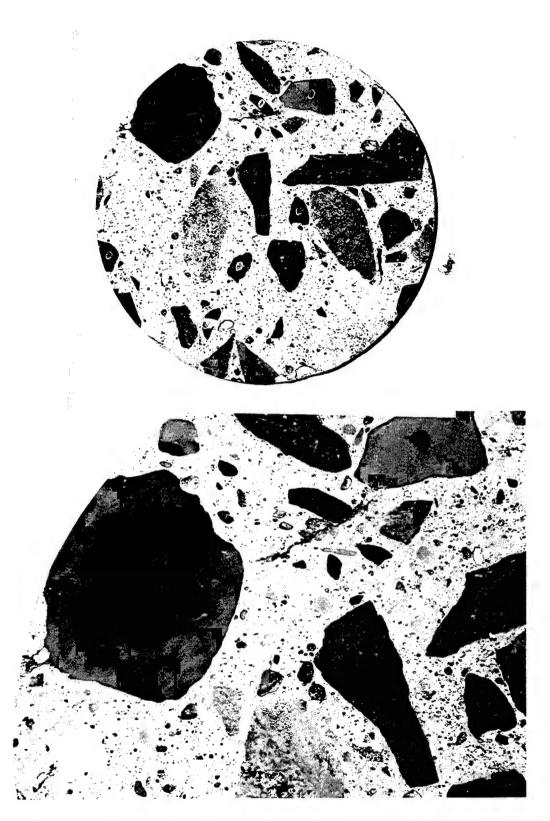


Figure A3b. Sample 950626 shows reactive aggregate particles at bottom of core. The sample is 6 in. (152 mm) left to right

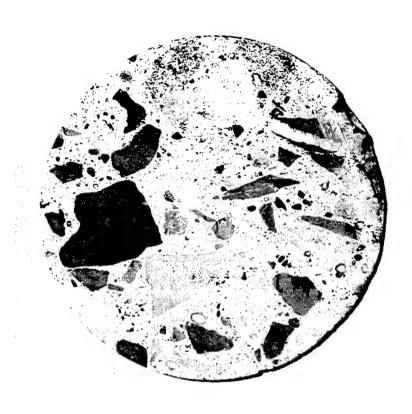


Figure A4. Sample 950627 shows no cracks. The sample is 6 in. (152 mm) left to right

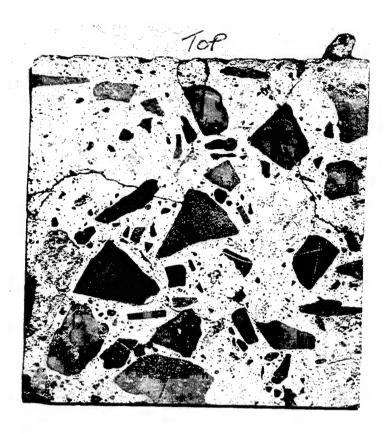




Figure A5a. Sample 950628 shows severe cracking in near surface concrete. Epoxy resin fills the cracks. Top sample is 6 in. (152 mm) left to right

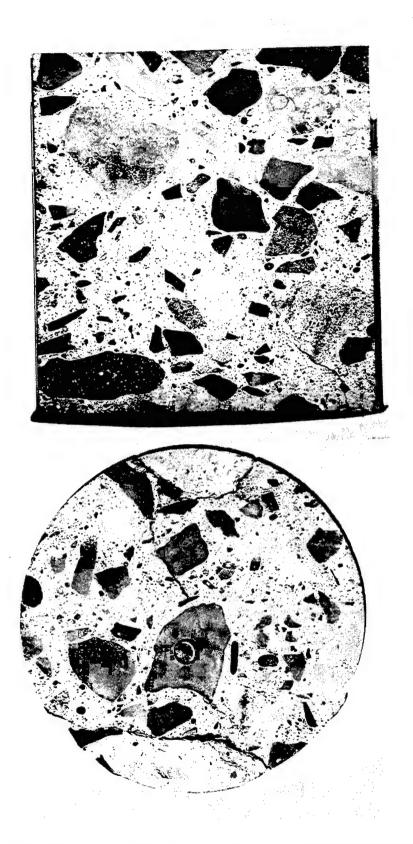


Figure A5b. Sample 950628 shows cracking is continuous throughout the entire length of core. Both samples are 6 in. (152 mm) left to right



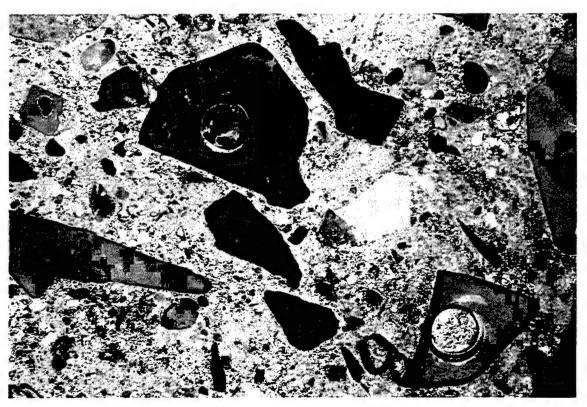


Figure A6. Sample 950620 shows aggregate reaction at the base of the core. Cracks are visible along the reaction rim. Top sample is 6 in. (152 mm) left to right

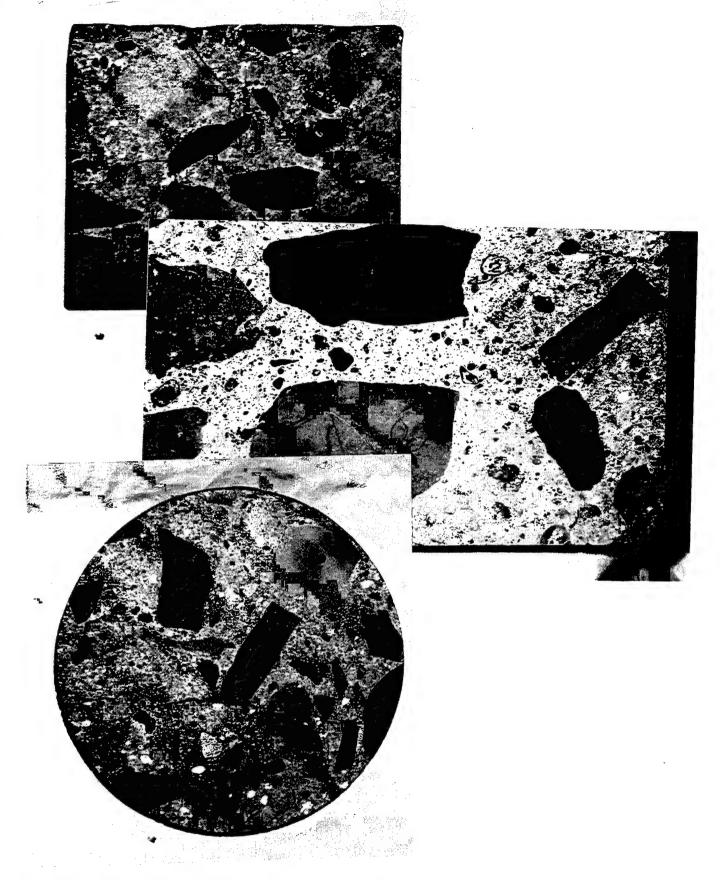
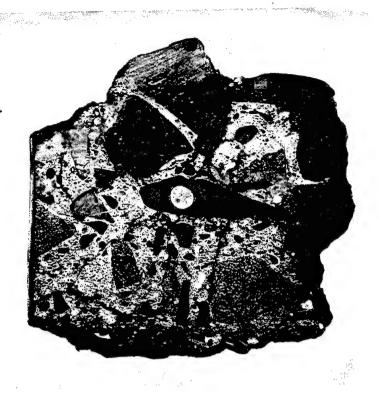


Figure A7. Sample 950619 shows random crack pattern with cracks propagating from two central reactive coarse-aggregate particles and cracking in bottom end of sample. Top and bottom samples are 6 in. (152 mm) left to right



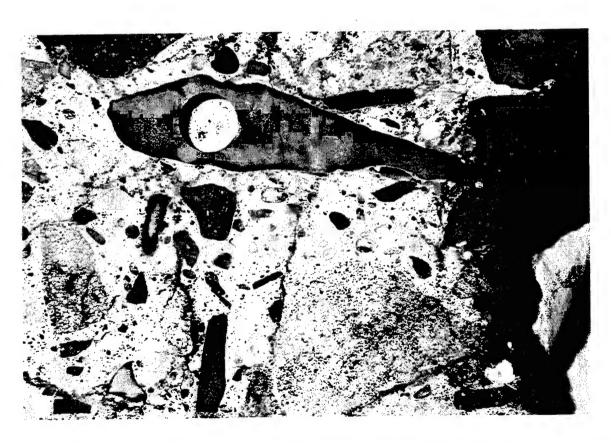
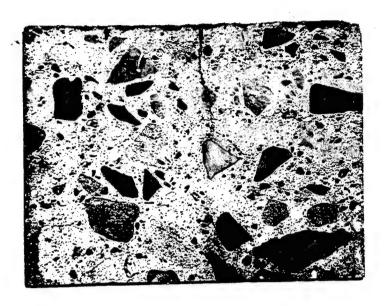


Figure A8. Sample 950617 shows a reactive aggregate particle and cracking of rim zone. Diameter core boring is 11 mm



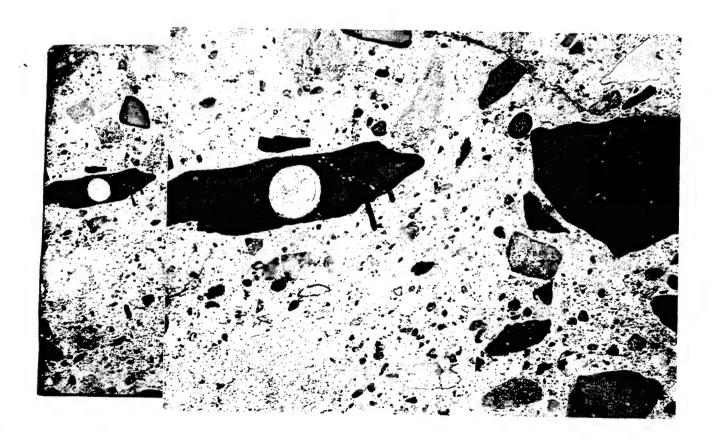
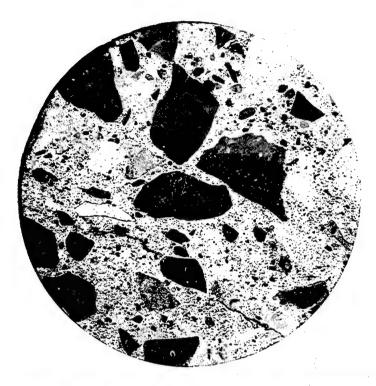


Figure A9a. Sample 950616 shows a central vertical near-surface crack and some incipient cracks associated with aggregate particle A. Samples on left are 6 in. (152 mm) left to right



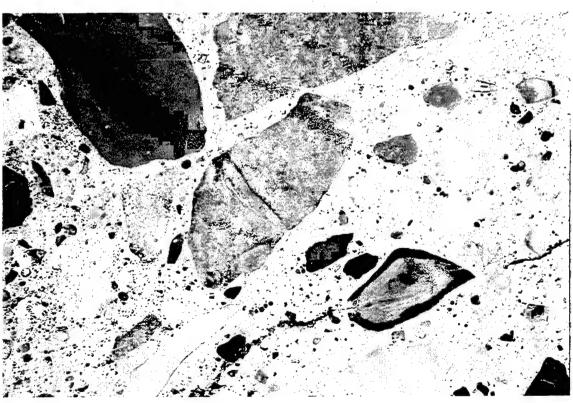
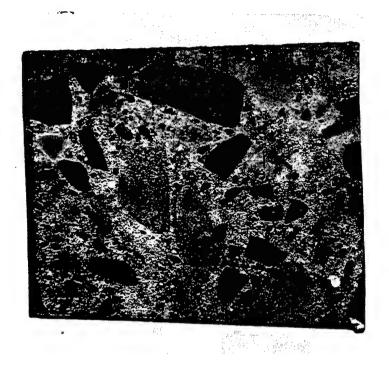


Figure A9b. Sample 950616 shows bottom of core and crack associated with reactive aggregate particle. Top sample is 6 in. (152 mm) left to right



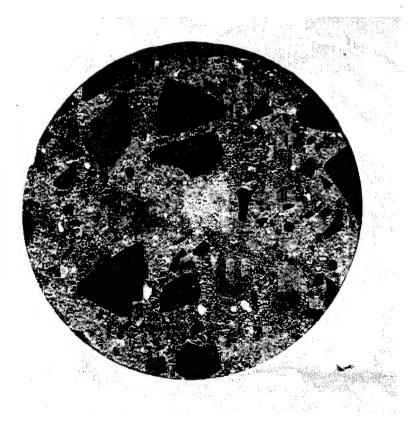
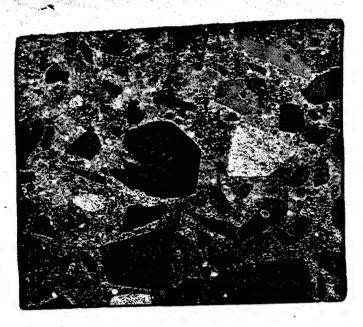


Figure A10. Sample 950622 shows intact concrete with mostly light-colored aggregate particles. Bottom slice of core contains hairline crack. Both samples are 6 in. (152 mm) left to right



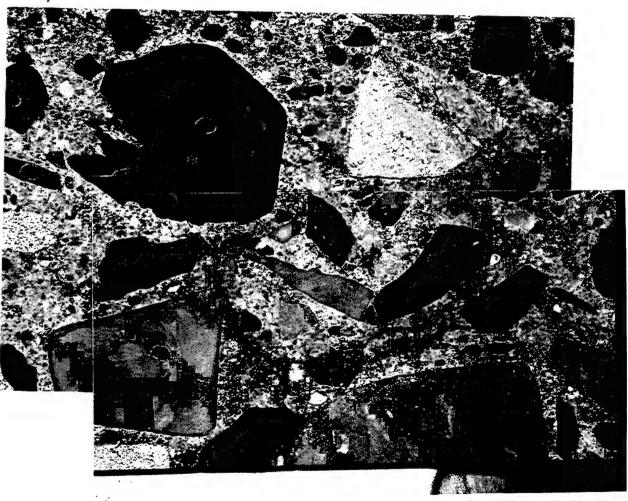


Figure A11. Sample 950618 shows random crack pattern with cracks propagating from central reactive coarse-aggregate particle. Other reactive particles are also evident. Top sample is 6 in. (152 mm) left to right

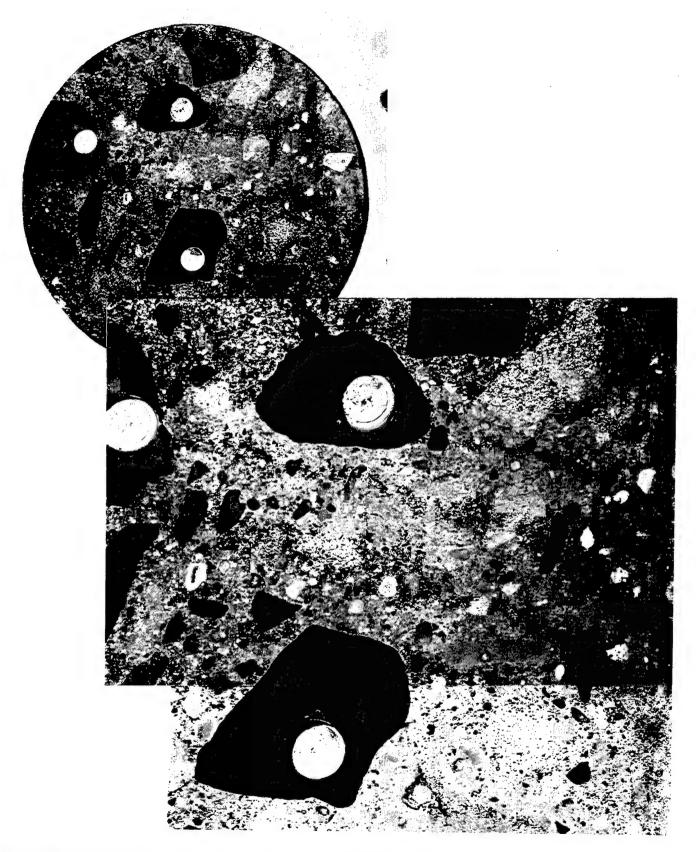


Figure A12. Sample 960621 shows aggregate particles A, B, and C. A is non-expansive, B is non-expansive, and C is expansive. Top sample is 6 in. (152 mm) left to right

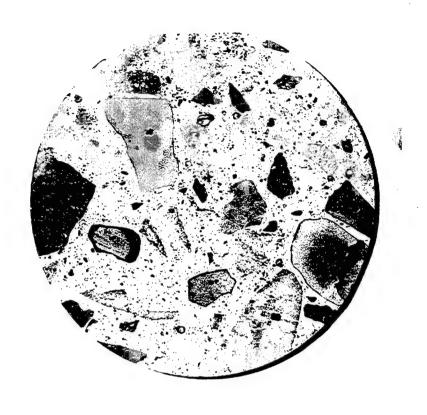




Figure A13. Sample 950615 shows some non-expansive reactive aggregate particles. Top sample is 6 in. (152 mm) left to right

## Appendix B U.S. Army Corps of Engineers Evaluation Data

Issued Sept 1971

STATE Ky.		IN	DEX NO	29	<u> </u>					v: OR			
LAT. 37	0	1.0	NG.	.6	380	DAT	TA SHE	ET	DATE	Novem	ber l	970	
LAB. SYMBOL	40	7196	-71					TYPE	OF . MATER	RIAL: CT	ushed	Lime	stone
		thla											<u> </u>
-	<u> </u>										•		
	<b>603</b>		Di		Pog	k Co							
PRODUCER	TI	ree	RI	vers	Roc	K CO.							
SAMPLED BY	Nas	shvi	lle	Dis	tric	t C.	of E	Pe	rsonn	el			
TESTED FOF	5	smit	hlai	nd L	&D	٠.							
PROCESSING BE										١			
ļ						<del> </del>	·						
GEOLOS.CAL FO	447-10	N AND	AGE										
GRADING (CRD	- 5 93	(CUM.	to PAS	S·NG)		T	EST RE	SULT	S		5" 1 1 - 3"	3 .15	FINE
		1,		FINE	1					3-6	, 15-3		c) AGG.
SIEVE . 3-6	1-1-3"	1 4 - 13	4-4	AGC.	BULK SP	GR SAT	SURE DR	(CRD-	C 107.108	):	2 70		72 2.61
SIEVE 3-6	<del>!</del>				ARCORD	ION CCC	CENT /CE	-6 :0-	1063:	× 5.6			
0.7		•	ļ		ABSORP	ION, PER	CENT (CKL	-6 107	, 106).	ψ.80	2 D • 1/1	1.22 0	.281.99
51N. 184.6		:			ORGANIC	IMPURIT	IES, FIG. N	C. (CRD	-C 121):		-		_
4IN 41.5	İ	1	1	i	SOFT P	ARTICLES,	PER CEN	CRD-	C 130):				_
31N 4.6	51.	4	1		PER CEN	T LIGHTE	ER THAN S	P. GR	(CRD-C	(29):			
25:4.	1	:	1	<del> </del>	-		AND ELONO						_
	12			<del> </del>									100
	12.			<u> </u>						4-1)(CRD	-C 115)		26.9
1316	1.4				ABRASIO!	1 LOSS (	L. A.), %,	(CRD-C	; 117):	В.		21	.5
LIN,		58.1			UNIT WT	., LB/CU	FT (CRD-	C !06)					
314. 1		14.7		1	CLAY LU	MPS, 76	(CRD-C	(8)					
\$ · N	i	4.2	69.8		COAL AN	D LIGNIT	E, % (CR	)-C 122	2):		-		
2:N.			40.8		SPECIFIC	HEAT, BT	TU/LB/DEG	. F. (CR	D-C (24)				$\neg$
NO.4			14.8				NaOH (						
NO.8		1.5	-	82.6		• • • • • • • • • • • • • • • • • • • •			Rc,r		-		-
							PROPERTI	-6 (60)					
NO. 16												*	
NO. 3G												AYS,	
NO.50	· .			29.5	LINEAR	THERMAI	L EXPANS	ION , XII	YDEG. F.	(CRD-C 1	25,126):		<u> </u>
NO. 100	i i			17.9		ROCK	TYPE	P	ARALLEL	ACROSS	, ON	AV	ERAGE .
NC.200											1		
- 200(-1													
F.M(b)					<u> </u>		<del></del>				-		
	لببا				L		·			1			
(e) CRD-C 105	(b) CR	D-C 10	04		MORTA	R:							
MORTAR - BAR EX	PANSION	O TA P	0F %	(CBD-	C 123):		FINE AG	GREGAT	E		COARSE A	GGREGAT	E
						3 MO.	6 MO.	9 MO	. 12 MO	. 3 MO.	6 MO.	9 MO.	12 MO.
LOW-ALK.CEM	ENT:	•	70 Naz	D EQUIT	VALENT:								
HIGH-ALK.CEM	ENT:	•	To Naz	O EQUIV	ALENT:						1		
SOUNDNESS IN	ONCRE										FET	HW-CD	HD-CW
						G: TL	00 P			DFE 300	-		1
	ewto				22000	Inr	ee Riv	ers			79.0	1	+
FINE AGG. Th	ree	Rive	rs		CARSE A	Mel	vin			DFE 300	81.9	<u> </u>	
Sample c	) ATAC	RD-C	127):		·ina	- inc	nto o	e a.	~~~	hard	nart	icles	. of
Oolitic													
stone.	Abo	ut 1	% t	0 29	6 of	each	samp	le c	onsis	ts of	mode	ratel	у .
hard to													
Limeston									x. sı	ze ag	grega	ce co	111-
sists of	no	tent	ial	lv r	react	ive (	Chert	•					
	PU												
	po												
	po												
REMARKS.													
REMARKS:										· · · · · · · · · · · · · · · · · · ·			
REMARKS													

WES FORM 726 JAN 1951

STATE		13.01	20.4	29 (	sup	01		REGATE	-	€0 8Y.		RDED-	-		
LAT	37.	100	c	88	<u> </u>		DAT	A SHEET	DAT						
	480L NO		75	271					TYPE OF M	ATERIAE	TH	shed	4CO3	rse A	ggreg
OCATIO	on. St	iith	land	i, K	у.						13	"-3"			
*0000	En T	'hre	e R:	iver	s Ü	uarry	·								
AUPLE	0 84	Na	shv	lle	Di	stric	t Cof	E per	sonne	1					Proj
ESTED	FOR E	lem	enta	ary	Acc	eptan	ce Te	sts f	or St	nithl	an	d Loc	ks	& Dam	Proj
SEC AT															
ROCES	SING PEF	DRE TE	STING												
	CAL FOR			GE							•				
												.·			
GRAD	ING ICED	-5 1631	(C_4 *	PASSIN	(a)		TEST	RESULTS					Ī		FINE
				1	1	1				3-4	6-	13-3	1-15	44-1"	AGG
*E V E	3-2.	19-3	1-1	*6-2	AGG	5 4.65	CD ( ( )	1CRD-C 101	108					2.6	2
				-		1		D-C 107, 10						2.3	3
614.	<del> </del>			-	-					-				-	
5 IN.	-		-	<del> </del>	<u> </u>			S, FIG. NO.		-					1
4 14.			-	<del>                                     </del>	<del> </del>			GR 2.0						-0-	
3 16				-	-								1	+ -	
t	-				-			ATED ICAD					<del>                                     </del>	16.4	<u> </u>
2 194								C Mg504 1C1			Δ		<del>                                     </del>	B5.7	
1, 16.			-	<del> </del>	-			ICRD-C		HADING _	-		1	1 . /	+
1 IN.				-				*CRD-C 106							<del>                                     </del>
IN.				-				S. T. CRO-C		-			-		1
- 14				1				9 DEG F. 10	T	.				1	
IN.				-	-		ITY WITH N		SC.MM						1
NC. 4						1CR	D-C 128.		140,44	-			<del>                                     </del>		
NO. 8	-			-										<del></del>	-
NO. 16	-			-		1		OPERTIES			1		DAYS		
NO. 30				-		TYPE		T, RATIO	DAY			C 125 126			
NO. 50				-		LINEAR		XPANSION							
0. 100	-			-		<b>}</b>	ROCK '	TYPE	PAR	ALLEL	ACI	POSS	DN	AVE	MAGE
C. 200			!			<del>                                     </del>				+					
-200'61	1		-	-		<b>├</b>								1	
F,M, (6)	L		L		L	<u> </u>	<del> </del>	•							
* CRD-C	105	(b) CR	D-C 104			MORTA	R.				1		1965 46	GREGATE	
OPTAR-	BAR EXP	ANSIO	AT 100	F. ". ICE	RD-C 12	91		FINE AGO		12 MO.	+,		MO	9 40.	12 40
							2 MC	6 MO	9 MO.	12 MO.	+ '			3	12.5
	LK. CEM					VALENT			-		+-				
	ALK. CEM					VALENT	<u> </u>	<u> </u>		144	.—		FAT	H#-CD	HD-C*
	ss 15 20	- }-					2 04		(#4-3	/4")	DFE,	. 17	3%		
FINE A		aD.	Sto	•		RSE AGG	2 KIV	ers O	uafr		DFE,				
FINE A		ATA IF	8D-C 12	71		RSE AGG									·i
M	ater	ial	cor	sis	ts	of a	compo	site	of st	one	fro	om			
I.	edae	s 7.	A. 7	B.	and	7C o	f thi	s qua	rry.					•	
						*									
ENARKS *	Masa		4	nc	26	ner C	יאם כ-	-3 100	1% na	ssino	1	's" ас	aa.		
	11930	4 9	Taul	.119	a o	Per C	ND C	5 100	,,o pa.		, -		, , -		
															,

Issued Sept 1975

								1988								
STATE	KY	IND	EX NO.:	2	9 Su	ppl 5	AG	GREGATE		TEST	ED BY	US	AE WE	S		
LAT.:	37	LO	1G.:	8	8		DA	TA SHEET		DATE	<b>E</b> :	Ma	rch,	1986		
LAB SY	MBOL NO	.:	VIC	KS-3.	3 M	G-8			TYP	E OF M	ATERIA	L: Ma	nufac	ture	Grav	el
LOCATI	ion: 7	mil	es N	E of	Smi	thlan	d, KY,	on Hw	y 6	0						
PRODUC	ER: I	hree	Rive	ers	Rock	Co.,	Smith	land,	KY	•						
													· · · · · · · · · · · · · · · · · · ·			·
SAMPLE	D #Y:	Vick	sburg	2 D1:	stri	ct										,
							ng Plai	nĖ	-							-
USED AT																
PROCES	SING BEF	ORE TE	ESTING:													
GEOLOG	ICAL FO	RMATIO	N AND A	GE:					٠.							
						•				·						
GRAC	ING (CR	D-C 1031	ICUM. S	PASSIN	G):		TES	T RESULT		-	$\neg$	-				
	T				1	1		, KESUE I			- 1 :	1-6"	1-3-	1-15	84-2"	FINE
SIEVE	3-6"	12-5	2-13	#4-}	FINE AGG.						- -			0 66		
	-					1	P GR. S.S.D			31				2.68	-	
6 IN.			-	-		ABSOR	TION, & ICI	10-C 107, 1	)6):					0.9	4	
5 IN.				·		ORGAN	C IMPURITE	ES, FIG. NO	. (CR	O-C 1211						
4 IN.	<del> </del>					SOFT F	ARTICLES.	LICRO-C 1	101							
3 IN.	-					% LIGHT	TER THAN S	P GR	CR	O-C 1221						
2 1 IN.			·			% FLAT	AND ELON	SATED ICR	D-C 11	9, 1201						
2 IN.						WT AV	LOSS, S CY	C M4504 (C	RO-C	1157						
1 1 IN.			100				RASION LOS				ADING	Α		25.2		
1 IN.			22				r, L8/CU F1		_					167.		1
₹ IN.			2			FRIABL	E PARTICLE	IS. 3 ICRO-	C 142	1				-	1	
₹ IN.			1			SPEC H	EAT, BTU/L	8/0EG F. (	CRD-C	1241						1
3 IN.			1			REACT	VITY WITH I	14QH		SC,MM/L			***********			
NO. 4	-		1			(0	RD-C 1281:		- 1	RC.MM/						
NO. 8	TOROGETEST: RC:MM/C:															
NO. 16						MORTA	-MAKING PE	OPERTIES	ICED	C 1161						
NO. 30							CEMEN							DAYS.		
NO. 50		,					THERMAL E									
NO. 100							ROCK					ACR		OH	1	
NO. 200													033	ON	AVE	AGE
-200(4)																
F.M. (6)									:							
(e) CRD-C	101	(b) CRO	~ 104			MORT			•						<del></del>	لــــــــــــــــــــــــــــــــــــــ
							Ť –	FINE AG				T :				
MORTAR-	BAR EXP	ANSION	AT 100F	. 3 (CR	O-C 123	1:	2 MO.	6.MO.			12 MO.	<b>—</b>		MO.	S MO.	
LOW-A	LK. CEME	NT:		= Nez	O EQUI	VALENT:		-	-			+			<b>3</b> mo.	12 MO.
HIGH-A	LK. CEM	ENT:				VALENT:						-		-		
SOUNDNE	55 IN CO	CRETE	ICRO-C	40, 114	):									FAT	HW-CD	
FINE A	GG.			-	COAR	SE AGG:						DFE			N#-CB	HO-CW
FINE A	<b>G</b> G.					SE AGG:						DFE 30				
PETROGR	APHIC D	ATA (CR	10-C 1271	:		-				-						
Three	lirer	ous	dolo	miti	c li	mesto	ne com	prised	th	e cr	ushe	d st	one s	amp1	e from	1
fine	to co	ers k	COCK		s Sm	ithia	nd Qua	rry.	0ve	r. 60	per	cent	is m	ediu	n gray	and
dark	grav	and	fine	to	TTHE	. Ap	proxim	ately	30	perc	ent	of t	he pa	rtic	les ar	e
consi	fine to coarse crystalline. Approximately 30 percent of the particles are dark gray and fine to coarse crystalline. Of the latter group, 12 percent are considered undesirable by the writer because of their biddle and the coarse crystalline.															
Hatur	considered undesirable by the writer because of their highly argillaceous nature (approximately 20 percent). About 1 percent of the sample is															
MCGCII	cred	and.	OI V	erv '	DOOL	quai	lev.	it ia	C110	Opet	<b>ad</b> +	hat	the a	11277	, ha i	nves-
weathered and of very poor quality. It is suggested that the quarry be investigated to determine if selective quarrying is feasible to eliminate the dark gray highly argillaceous rocks.																
gray	highl	y ar	gill	aceo	us r	ocks.	•									••
REMARKS:																
							,									

ENG FORM 6011-R

Encl 17 to Encl 1

STATE: KY	INDEX NO.:	29 Suppl 3	RIPRAP	TESTED BY.	SAD Labo	ratory
LAT.: 37	LONG.:	88	DATA SHEET		SAD Labo July 198	6
LAB SYMBOL NO.	57/301	3 E. of Smithland		E OF MATERIAL		
LOCATION:	o.2 miles	E. of Smithland	K1 011 03 60			
PRODUCER:	hree Riv	ers Rock Quarry				•
		CESAM-EN-FG)				
	liver L&	D Replacement		<del></del>		<del> </del>
USED AT:			· · · · · · · · · · · · · · · · · · ·		-,	
PROCESSING BEF	ORE TESTIN	G:				
GEOLOGICAL FO						
		TEST ME	THOD			RESULTS
BULK SPECIFIC O		O, (CRD-C 107)	· · · · · · · · · · · · · · · · · · ·			
ABSORPTION, % (		(CRD-C 132)				
LA ABRASION L	OSS. % (CRD	C 145 OR RTH-115), GRA	OING 1.			
UNIT WT., LE/CU						
WETTING AND DI						
FREEZE AND TH			. of 11 pieces			1.5
		LYCOL (CRD-C 148)				
PETROGRAPI	HIC DATA	(CRD-C 127)				
		1				
			ı			
			* * * * * * * * * * * * * * * * * * * *			
·						
		4				
	4				•	
			•			
	i					
REMARKS						
·				2		
		,				
					-	
				•		
ENG FORM 60	12-R, Jul 8	81	(ER 1110-1-2005)		·	oponent DAEN-CWE-D

RIPRAP TESTED BY: USAEWES INDEX NO.: 29 STATE. Suppl 4 DATA SHEET DATE: March 1986 LAT. LONG .: 88 37 Limestone TYPE OF MATERIAL: LAB SYMBOL NO .: VICKS 33 RR-8 LOCATION: KY on Hwy 60 7 miles NE of Smithland, Three Rivers Rock Co., Smithland, KY PRODUCER: SAMPLED BY: Vicksburg District Yazoo Backwater Pumping Plant TESTED FOR: USED AT: PROCESSING BEFORE TESTING: GEOLOGICAL FORMATION AND AGE: RESULTS **TEST METHOD** BULK SPECIFIC GRAVITY, SSD, (CRD-C 107) 2.73 n ABSORPTION, % (CRD-C 107) WT. AV. % LOSS, 5 CYC. MGSO, (CRD-C 137) 27.0 L.A. ABRASION LOSS, % (CRD-C 145 OR RTH-115), GRADING 1. 170.1 UNIT WT., LB/CU FT (CRD-C 107) 0.7 WETTING AND DRYING, %, 35 CYCLES FREEZE AND THAW, % (CRD-C 144) 20 CYCLES 20.7 EXPANSION IN ETHYLENE, GLYCOL (CRD-C 148) PETROGRAPHIC DATA (CRD-C 127) This rock was a light olive gray, fine-grained limestone. The rock is slightly fossiliferous, with bedding planes 0.01 ft apart. The rock is composed of calcite, dolomite, quartz, and kaolinite. This rock should perform adequately for use as riprap.

RE	MΑ	R	KS
----	----	---	----

ENG FORM 6012-R, Jul 81

(ER 1110-1-2005)

(Proponent DAEN-CWE-DC) Encl 26 to Encl 1

#### Issued October 1982

STATE KY	INDEX NO.: 29 (Suppl 2)	RIPRAP	TESTED BY: USAEWES
LAT: 37	LONS. 88	DATA SHEET	DATE: March 1979
LAP SYMPOL NO	∘ NO-57 G-136	TY	PE OF WATERIAL RIPTAP
LOCATION: ]	mile east of Hwy 60 and	d 4.8 miles n	orth of intersection of Hwys 60
and 70			
PRCDUCES:	Three Rivers Rock Co.,	Box 218, Smit	hland, KY 42081
SAMPLED BY.	Dames & Moore		
TESTED FOR: 1	New Orleans District		
JSEC AT.			
PROCESSING BE	FORE TESTING: As required		
GEOLOGICAL FO	ORMATION AND AGE: Ste. Genevi	eve Fm Mer	amec Group - Mississippian Age
		TEST RESULTS	

RESULTS TEST METHOD Bulk Specific Gravity, SSD, (CRD-C 107) 2.69 Absorption, % (CRD-C 107) 0.3 Wt. Av. % Loss, 5 Cyc. MgSO₄ (CRD-C 137) L.A. Abrasion Loss, % (CRD-C 145 or RTH-115), Grading 1. 0.0 22.8 Unit Wt., 1b/cu ft (CRD-C 107) 167.6 Wetting and Drying, %, 35 cycles 6.1 Freeze and Thaw, % (CRD-C 144) 20 cycles 0.3 Expansion in Ethylene, Glycol (CRD-C 148)

#### PETROGRAPHIC DATA (CRD-C 127)

NO-57 G-136 (Three Rivers Rock Co.). All three pieces were medium light gray coarse-grained dolomitic limestone with a minor amount of quartz; two of the three pieces were oolitic. Chert was present as layers between beds. The rock was not substantially affected by freezing and thawing.

REMARKS

New Orleans Sample No. LIV-1-1A, 1B, 1C.

1989

STATE KY INDEX NO .: 29 (SUPDI 6) RIPRA	P TESTED BY: USAEWI	S .
LAT.: 37 LONG.: 88 DATA SE	EET DATE: Jul 88	
LAB SYMBOL NO .: IMK-4 RR-16, RR-17, RR-18		stone
LOCATION: Three River Quarry Bench No. 2, 3, at	nd 4, St. Genevieve Form	nation Smithland
KY	·	
PRODUCER: Drawco Basic Materials Co., Inc.,	Smithland, KY	
SAMPLED BY: Vicksburg District		
TESTED FOR: Lock and Dam No. 4 and No. 5, Red I	liver	
USED AT:		<del> </del>
PROCESSING BEFORE TESTING:		
GEOLOGICAL FORMATION AND AGE:	PP_17	PP-16
TEST METHOD		RESULTS
BULK SPECIFIC GRAVITY, SSD, (CRD-C 107)	2.69	2.71
ABSORPTION, % (CRD-C 107)	0.6	0.7
WT. AV. % LOSS, 5 CYC. MGSO ₄ (CRD-C 137)		
LA. ABRASION LOSS, % (CRD-C 145 OR RTH-115), GRADING 1.		
UNIT WT., LE/CU FT (CRO-C 107)	168	169
NETTING AND DRYING, %, 35 CYCLES	0.1	0.1
FREEZE AND THAW, % (CRD-C 144) 20 CYCLES	13.7	3 0
EXPANSION IN ETHYLENE, GLYCOL (CRD-C 148)		· · · · · · · · · · · · · · · · · · ·
		<del></del>

#### PETROGRAPHIC DATA (CRD-C 127)

These three samples represent benches 2, 3, and 4 of the same quarry. All three are light olive gray to medium dark gray dolomitic limestones from the St. Genevieve Formation. The rocks are very fine-grained (<0.1 mm), moderately hard to hard, slightly weathered, and massive. Samples LMK-4 RR-16 and RR-17 consist of calcite, dolomite, and quartz. Sample RR-16 contains a minor amount of plagioclase feldspar. RR-18 consists only of dolomite and quartz.

#### REMARKS

These rocks are similar to material previously tested. No physical tests were performed on LMK-4 RR-18; however, petrographic analyses on LMK-4 RR-16, RR-17, and RR-18 do not indicate any specific features that would preclude their use as riprap.

ENG FORM 6012-R, Jul 81

(ER 1110-1-2005)

(Proponent DAEN-CWE-DC)

Issued Sept. 1973 TESTED BY: ORDL **AGGREGATE** STATE KY. INDEX NO. May 1972 DATA SHEET DATE LONG 88 37 Blending Sand 72125 & 72127 TYPE OF MATERIAL LAB SYMBOL NC. LOCATION: Near Ledbetter, off US 60 on bluff overlooking Ohio River - Dubuque Ridge Contractor Dravo-Groves-Newberg, Nashville District C. of E. Personnel SAMPLED BY. TESTED FOR Smithland Locks & Dam PROCESSING BEFORE TESTING SECLOGICAL FORMATION AND AGE GRADING (CRD-C 103) (CUM. 5 PASSING) TEST RESULTS 2-15 AGG. SIEVE 2.53 2.54 BULK SP GR, S.S.C. (CRO-C 107, 108) 5 :N. ABSORPTION, 7: CRD-C 107, 108: ī ORGANIC IMPURITIES, FIG. NO. ICRD-C 1211 SOFT PARTICLES, TICRO-C 130 T LIGHTER THAN SP GR_ 27 1 * FLAT AND ELONGATED CRD-C *19, 120 WT AV . LOSS, 5 CYC MgSO4 CRD-C 115" · ; IN. L.A. ABRASION LOSS, T. CRD-C 117, 1451 GRADING · IN. UNIT WT, LB CU FT ICRO-C 106 } .N. FRIABLE PARTICLES, % 1CRD-C 1421 ÷ 18 SPEC HEAT, BTU 'LB 'DEG F. (CRD-C 124) REACTIVITY WITH NOOH SC,MM/L NO. 4 99.7 98. NO. 8 96. 99.6 NO. 16 SMORTAR-MAKING PROPERTIES (CRD-C 116) NO. 30 99 97.9 92 LINEAR THERMAL EXPANSION MILLIONTHS DEG F. ICRD-C 125, 126 NO. SC 70.1 NO. 100 54. PARALLEL ACROSS AVERAGE 13.8 NO. 200 -200'4 F.M. b. 4. CRD-C 105 16 CRD-C 104 MORTAR-BAR EXPANS ON AT 100F, 5 (CRD-C 123); 12 MO LOW-ALK, CEMENT: " NOZO EQUIVALENT: - G--ALK. SEMENT. " NOZO EQUIVALENT. SOUNDNESS IN CONCRETE (CRO-C 40, 1141) FAT HW-CD HD-C# F NE ASS. COARSE AGG: DFE F NE 455. PETEOGRAPH.C DATA CRO-0 127 #72125 <u>#72127</u> Quartz - - - - -67.5% 85.4% Siltstone -2.4% 1.1% Igneous Grains - -1.4% 0.6% 9.7% 30.4% Clay Lumps - -Mica - - - - - -1.0% 0.4% Organic Material 0.1% trace Sample #72125 is a bulk sample while #72127 is an auger sample through the entire stratum.

**B9** 

51: 15=v 5: 1.=

Issued Sept. 1973 TESTED BY STATE KY INDEX NO.: AGGREGATE ORDL DATA SHEET May '72 88 DATE. 37 TYPE OF MATERIAL: Blending Sand LAB SYMBOL NO. 72126 Dubuque Pit near Ledbetter off of U.S.60 LOCATION: overlooking the Ohio River PRODUCER Dravo-Groves-Newberg, Contractor Nashville Dist. C.ofE. personnel SAMPLEC BY: Smithland L&D TESTED FOR: Barkley Dam USED AT: PROCESSING BEFORE TESTING: SEOLOGICAL FORMATION AND AGE GRADING (CRD-C 103) (CUM. * PASSING): TEST RESULTS 24.1" 3-6" 1 3-3" 3-13 SIEVE 1:-3 3-15 *4-2 BULK SP GR, S.S.D. (CRD-C 107, 198) 2.60 EIN. ABSORPTION, 7 (CRD-C 107, 108). 0.7 5 IN. ORGANIC IMPURITIES, FIG. NO. 'CRD-C 1211 SOFT PARTICLES, " :CRO-C 130 3 IN. LIGHTER THAN SP GR_ _ ICRD-C 122 2 in. FLAT AND ELONGATED ICRD-C 119, 1201 2 :4. WT AV " LOSS, S CYC MgSO4 (CRO-C 115-: j .s. ABRASION LOSS, 7 (CRD-C 117, 145) GRADING - 14. UNIT WT, LB CU FT ICRD-C 1961 · · · . FRIABLE PARTICLES, T (CRD-C 142) . s. SPEC HEAT, BTU 'LB 'DEG F, 'CRD-C 1241 1 18. REACTIVITY WITH NOOH ND. 4 ICRO-C 1281: NO. a NC. 15 MORTAR-MAKING PROPERTIES (CRO-C 115) NC. 30 CEMENT, RATIO: 90.4 LINEAR THERMAL EXPANSION MILLIONTHS DEG F. ICRD-C 125, 1261: 27.7 PARÁLLEL AVERAGE NO. 200 -20C-G (b) CRD-C 104 FIÑE AGGREGATE MORTAR-BAR EXPANSION AT 100F, F ICRD-C 123:: COARSE AGGREGATE 5 MO. 9 MO. 12 MO. 3 MO. -OH-ALK. CEMENT. " NEZO EQUIVALENT: -- GH-4_K, CEMENT - NOZO EQUIVALENT SCUNDNESS IN CONCRETE CRD-C 40, 1141: F6~ HW-CD HD-CW COARSE AGG: DFE 300 F 45 455. COARSE AGG. =E==53=4=+;5 54=4 SRD-5 127. Quartz - - - - - - -Siltstone - - - - -8% Igneous Rock Fragments - - - 4% Weathered Rock Fragments -trace PEVARKE 112 (130 Sirve

### REPORT DOCUMENTATION PAGE

Form Approved OMB No. 0704-0188

Public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Washington Headquarters Services, Directorate for Information Operations and Reports, 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA22202-4302, and to the Office of Management and Budget. Paperwork Reduction Project (0704-0188), Washington, DC20503.

Office of Management and Budget, Paperwork Reduction	2.REPORT DATE	3.REPORT TYPE AND D	ATES CO	VERED
1.AGENCY USE ONLY (Leave blank)	January 1998	Final report	A12000	
4.TITLE AND SUBTITLE			5.FUNDIN	IG NUMBERS
Investigation of Concrete from I-2	20 Near Monroe, Louisian	na		
6.AUTHOR(S) G. Sam Wong				
7.PERFORMING ORGANIZATION NAME	E(S) AND ADDRESS(ES)		8.PERFO	RMING ORGANIZATION
U.S. Army Engineer Waterways I		• 0		TNUMBER
3909 Halls Ferry Road, Vicksburg	g, MS 39180-6199		Misce	ellaneous Paper SL-98-1
9.SPONSORING/MONITORING AGENC	Y NAME(S) AND ADDRESS	E(ES)		SORING/MONITORING CY REPORT NUMBER
U.S. Army Corps of Engineers Washington, DC 20314-1000			AGEN	
11.SUPPLEMENTARY NOTES  Available from National Technic	cal Information Service, 5	5285 Port Royal Road, Spring	gfield, V	A 22161.
12a.DISTRIBUTION/AVAILABILITY STA	TEMENT		12b.DIST	RIBUTION CODE
Approved for public release; di	stribution is unlimited.			
13.ABSTRACT (Maximum 200 words)  This report covers an investig deterioration in certain lanes of I of Engineers Waterways Experin distressed and non-distressed are role of alkali-carbonate-rock react to the deterioration; and (d) the creport includes the results of these	-20 east and west of Monnent Station at the request as from different sections ction; (b) the role of alkalic contribution of fresh concri-	roe, LA. The investigation value to f the Louisiana Department of the roadway were evaluation; (c) the contraction of the properties and constructions.	vas condu to of Tran- ted to det ibution o on practic	sportation. Cores taken from ermine the following: (a) the freezing-and-thawing action
14.SUBJECT TERMS				15.NUMBER OF PAGES

**18.SECURITY CLASSIFICATION** 

**UNCLASSIFIED** 

OF THIS PAGE

Standard Form 298 (Rev. 2-89) Prescribed by ANSI Std. Z39-18 298-102

**20.LIMITATION OF ABSTRACT** 

80

19.SECURITY CLASSIFICATION

**OF ABSTRACT** 

16.PRICE CODE

NSN 7540-01-280-5500

OF REPORT

Concrete

Concrete pavement

17.SECURITY CLASSIFICATION

**UNCLASSIFIED**